

Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281	
Equipment 4000536430	Service Notification 500245510	QN Number 200344199	Insp. Lot 50000340070

1.	MIC : E1050280 LIPSKIN SEGMENT: IPL 71-11-19-03-30 Discrepancy : C200 CORROSION   Corrective Action : 1. AAR2 REPAIR IAW SRM 54-01-01 PARA 2.A (ASSY) REPAIR IAW SRM 54-01-01 PARA 2.A Lip skin noted with minor scratches and minor surface corrosion throughout. 2. C48B INSPECT IAW NTM 51-10-04-PB4
2.	MIC : E1050290 LIPSKIN SEGMENT: IPL 71-11-19-03-40 Discrepancy : C200 CORROSION Corrective Action : 1. AAR2 REPAIR IAW SRM 54-01-01 PARA 2.A (ASSY) REPAIR IAW SRM 54-01-01 PARA 2.A 2. C48C INSPECT IAW NTM 51-10-04-PB4
3.	MIC : E1050300 LIPSKIN SEGMENT: IPL 71-11-19-03-50 Discrepancy : C200 CORROSION Corrective Action : 1. AAR2 REPAIR IAW SRM 54-01-01 PARA 2.A (ASSY) REPAIR IAW SRM 54-01-01 PARA 2.A 2. C48D INSPECT IAW NTM 51-10-04-PB4
4.	MIC : E1050000 CFM56-5B INLET COWL 642-1000-xxx Discrepancy : R312 REQUIRES SURFACE FINISH/PROTECTION

Discrepancy Report


Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281	
Equipment 4000536430	Service Notification 500245510	QN Number 200344199	Insp. Lot 50000340070



Corrective Action : 1. DDQ2 REPLACE IAW CMM 71-11-19 REP 02

5. **MIC :** E1050000 CFM56-5B INLET COWL 642-1000-xxx

Discrepancy : R315 REQUIRES SEALANT

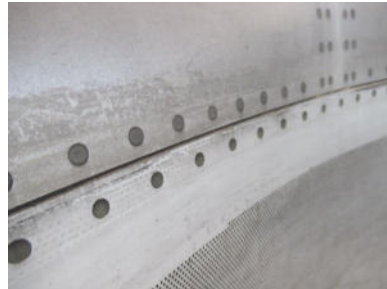

Corrective Action : 1. CZ32 REPAIR IAW CFM56-5B CMM 71-11-19 REP 01
Outer barrel aerodynamic sealant noted as worn throughout.
Inner barrel aerodynamic sealant noted as worn throughout.

6. **MIC :** E1070300 CONDUCTIVE STRIP: IPL 71-11-19-1-377

Discrepancy : D100 DAMAGED

Discrepancy Report

Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281
Equipment 4000536430	Service Notification 500245510	QN Number 200344199
		Insp. Lot 50000340070

	  Corrective Action : 1. FH95 FAB IAW RSM 731-1 SPF: 642-1000-51 Conductive strips worn.
7.	MIC : E1050390 STRIP-CONDUCTIVE: IPL 71-11-19-01-170 Discrepancy : W200 WORN Corrective Action : 1. AAS8 REPLACE REF IPL 71-11-19-01-170, 180 Conductive strips worn.
8.	MIC : E1050300 LIPSKIN SEGMENT: IPL 71-11-19-03-50 Discrepancy : C319 CRACKED WITHIN REPAIRABLE LIMITS   Corrective Action : 1. AAQ5 REPAIR IAW CMM 71-11-19 REP 021 Lip skin noted with crack at the 7.30 o'clock location.
9.	MIC : E1050300 LIPSKIN SEGMENT: IPL 71-11-19-03-50 Discrepancy : D408 DENTED WITHIN LIMITS

Discrepancy Report

Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281
Equipment 4000536430	Service Notification 500245510	QN Number 200344199
		Insp. Lot 50000340070

	 
	Corrective Action : 1. AAQ6 REPAIR IAW CMM 71-11-19 REP 022 lip skin noted with minor dent at 5 o'clock location 3" x 1.5" 0.050" deep.
10.	MIC : E1050000 CFM56-5B INLET COWL 642-1000-xxx Discrepancy : R311 REQUIRES STENCILS Corrective Action : 1. CZO7 REPAIR IAW SRM 54-02-03, PARA. 1-3
11.	MIC : E1050000 CFM56-5B INLET COWL 642-1000-xxx Discrepancy : R350 REQUIRES ALUMINIZED PRIMER Corrective Action : 1. A29Q REPAIR IAW SRM 54-02-07 GEN-REP
12.	MIC : E1050005 RUBSTRIPS IPL 71-11-19-01-90 to 160 Discrepancy : 0320 DAMAGED / LOOSE / WORN Corrective Action : 1. A14L REPAIR IAW NRP 4604-02-01 5.4-5.5
13.	MIC : E1050220 RING-ENGINE ATTACH: IPL 71-11-19-01-691 Discrepancy : R519 REMOVE & REINSTALL ENGINE RING IS TO REmain and various badly installed fasteners to be removed and replaced.

Discrepancy Report


Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281
Equipment 4000536430	Service Notification 500245510	QN Number 200344199
		Insp. Lot 50000340070

	Corrective Action :	1. 08YW INSTALL IAW CMM 71-11-19 REP 17/18/19
14.	MIC :	E1050130 BOOT, ANTI-ICE EX: IPL 71-11-19-01-680
	Discrepancy :	G167 GOUGED / WORN WITHIN REPAIR LIMITS
	Corrective Action :	1. 09L0 REPAIR IAW NRP 4604-03-01
15.	MIC :	E1050250 SEAL-PACKING,A/ICE: IPL 71-11-19-01-720
	Discrepancy :	F100 FRAYED
	Corrective Action :	1. AAU6 REPLACE REF IPL 71-11-19-01-720
16.	MIC :	E1050260 TUBE ASSY, A/ICE: IPL 71-11-19-1-780/785
	Discrepancy :	D100 DAMAGED
	 	
	Corrective Action :	1. 08IN UPGRADE IAW SB RA32071-126
17.	MIC :	E1050260 TUBE ASSY, A/ICE: IPL 71-11-19-1-780/785
	Discrepancy :	R524 REMOVED TO FACILITATE REPAIR
	Corrective Action :	1. EG72 INSTALL IAW CMM 71-11-19 ASSY 1.C.(5c-g)
18.	MIC :	E1050260 TUBE ASSY, A/ICE: IPL 71-11-19-1-780/785

Discrepancy Report

Material Number & Description 642-1000-501 NOSE COWL, CFM56-5B	Serial Number 5809001	Originated By 500281	
Equipment 4000536430	Service Notification 500245510	QN Number 200344199	Insp. Lot 50000340070

Discrepancy : W2B5 WORN PLASMA COATING
PLASMA COATING AND PROOF LEAK TEST REQUIRED

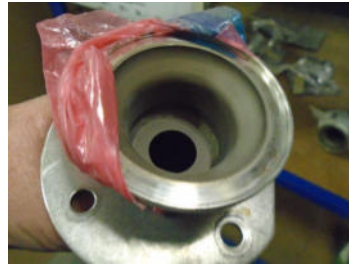

Corrective Action : 1. AAQ1 REPAIR IAW CMM 71-00-17 REP 014 OSP

Material Number & Description 642-1026-501 DOOR, PRESSURE RELEASE CFM56-5B	Serial Number N/A	Originated By 500281	
Equipment 4000536435	Service Notification 500245510	QN Number 200344194	Insp. Lot 50000340074

1. **MIC :** E1050212 HINGE, PRESS.-REL: 71-11-19-1-590

Discrepancy : 0008 CRACKED / WORN



Corrective Action : 1. 09IP REPAIR IAW CMM 71-11-19 ASSY 1C(7a)

Outer barrel access panel noted with worn hinge.

Material Number & Description 642-1029-513 PANEL, UPR	Serial Number N/A	Originated By 500281	
Equipment 4000536437	Service Notification 500245510	QN Number 200344195	Insp. Lot 50000340075

1. **MIC :** E1050700 PANEL ASSY, UPR: IPL 71-11-19-01-449A

Discrepancy : E200 ERODED



Corrective Action : 1. ABF5 REPAIR IAW CMM 71-11-19 REP 04

Outer skin noted with air erosion throughout the forward edge.

Material Number & Description 642-1029-509 PANEL, LOWER	Serial Number N/A	Originated By 500281	
Equipment 4000536434	Service Notification 500245510	QN Number 200344196	Insp. Lot 50000340073

1. **MIC :** E1050710 PANEL ASSY, LWR: IPL 71-11-19-01-453


Discrepancy : E200 ERODED



Corrective Action : 1. ABF5 REPAIR IAW CMM 71-11-19 REP 04

Outer skin noted with air erosion throughout the forward edge.

Material Number & Description 642-1025-505 PANEL ASSY, INNER BARREL CFM56-5B	Serial Number N/A	Originated By 500281	
Equipment 4000536433	Service Notification 500245510	QN Number 200344197	Insp. Lot 50000340072

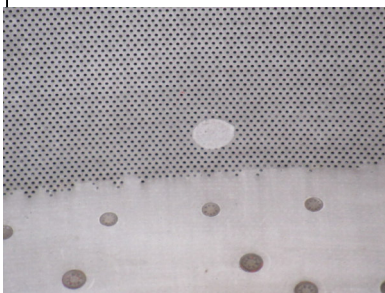1.	MIC : E1050012 LWR ACOUSTIC PNL: 642-1025-517 Discrepancy : ZZZZ PREVIOUS REPAIR NOTED   Corrective Action : 1. ZZZZ NO ACTION REQUIRED Lower left acoustic panel noted with previous repairs at the 1.30 o'clock aft location 0.5" in diameter. Lower left acoustic panel noted with previous repairs at the 3 o'clock aft location 0.5" in diameter. Lower left acoustic panel noted with previous repairs at the 3.30 o'clock aft location 0.5" in diameter. Lower left acoustic panel noted with previous repairs at the 4 o'clock aft location 0.5" in diameter.

Material Number & Description 642-1025-507 ACOUSTIC PANEL, CFM56-5B	Serial Number N/A	Originated By 500281	
Equipment 4000536431	Service Notification 500245510	QN Number 200344198	Insp. Lot 50000340071

1. **MIC :** E1051120 L/H ACOUSTIC PANEL IPC 71-11-19-1-456B

Discrepancy : ZZZZ PREVIOUS REPAIR NOTED



Corrective Action : 1. ZZZZ NO ACTION REQUIRED

Lower right acoustic panel noted with previous repairs at the 6 o'clock aft location x 2 both 0.5" in diameter.