

1. Approving Competent Authority / Country: European Aviation Safety Agency		2		AUTHORISED RELEASE CERTIFICATE EASA FORM 1				3. Form Tracking Number: D 2318214A	
4. Organization Name and Address: Panasonic Dubai Airport Free Zone (DAFZ), PO Box 54340, Dubai UAE Telephone: + 971 (0) 4 212 3100. Fax: + 971 (0) 4 299 5652				5. Work Order/Contract/Invoice RO-002482-2014					
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No	11. Status / Work				
1	CABIN MANAGEMENT TERMINAL	RD-AA8046-11	1	C610030	REPAIRED				
12. Remarks UNIT REPAIRED, CHECKED AND INSPECTED IAW CMM 23-33-28 REV. 30 DTD FEB. 2014.									
Panasonic Avionics Corporation internal reference SR3725734									
13a. Certifies the items identified above were manufactured in conformity to: ☐ approved design data and are in a condition for safe operation. ☐ non-approved design data specified in block 12.					14a. ☒ PART 145.A.50 Release to Service ☐ Other regulation specified in block 12 Certifies that unless otherwise specified in Block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.				
13b. Authorised Signature:		13c. Approval/Authorization Number			14b. Authorized Signature: 		14c. Certificate/Approval Ref No: EASA 145.0480		
13d. Name		13e. Date (dd mmm yyyy)			14d. Name Clifford Fernandes		14e. Date (dd mmm yyyy) 08-NOV-2014		
USER/INSTALLER RESPONSIBILITIES									
This certificate does not automatically constitute authority to install the item(s).									
Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1.									
Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.									



Panasonic Avionics Corporation

Dubai Repair Station

PO Box 54340, Dubai Airport Free Zone, Dubai, UAE

Tel: +971 4 2123100 Fax: +971 4 2995652

REPAIR REPORT / DELIVERY ORDER

SOLD TO YEMEN AIRWAYS
FINANCE DEPARTMENT
GENERAL ACCOUNT
PO BOX 10600
SANA'A, REPUBLIC OF YEMEN , YE

SHIP TO YEMEN AIRWAYS
DIRECTOR MATERIAL
YEMEN AIRWAYS
PO BOX 10600
SAANN, , YE

PAGE 1 of 1

SHIP TRANSACTION:



CUSTOMER P.O. NUMBER RO-002482-2014		CUSTOMER 1416	TAIL NO. 70-ADT	CUST PROD REF 4000726	SERVICE REQUEST 3725734	
PART NUMBER RD-AA8046-11	NOMENCLATURE CABIN MANAGEMENT TERMINAL			DATE REMOVED 11-AUG-2014	DATE RECEIVED 04-SEP-2014	
SERIAL NUMBER C610030	DATE OF MFG 30-JUL-2004	WTY START DATE 07-JUN-2005	WTY END DATE 06-JUN-2008	DATE REPAIRED 03-NOV-2014	SHIP DATE	
MOD IN 1-4						
REASON FOR CUSTOMER REJECTION	CMT SCREEN INTERFERENCE.					
INTERNAL INSPECTION	No Physical Damage WORN OUT COOLING FANS, DIRTY, DUSTY.					
EXTERNAL INSPECTION	No Physical Damage DIRTY, DUSTY, MINOR DENT ON CORNER.					
ACTUAL FAILURE / CORRECTIVE ACTION	UNIT TESTED - REPORTED FAILURE CONFIRMED. FOUND CMT SCREEN FLICKERING AND HORIZONTAL WHITE LINES ON DISPLAY DUE TO DEFECTIVE CORE BOARD ASSY. ALSO FOUND WORN OUT COOLING FANS. DIRTY, DUSTY. UNIT STRIPPED AND CLEANED. REPLACED CORE BOARD ASSY. AND COOLING FANS. INSTALLED FACTORY LOAD SOFTWARE AND CALIBRATED THE TOUCH SCREEN. UNIT FINAL TESTED - PASSED. UNIT REPAIRED, CHECKED AND INSPECTED IAW CMM 23-33-28 REV. 30 DTD FEB. 2014.					

MOD OUT: 1-4

INSPECTED BY: **Clifford Fernandes**REPAIRED BY: **MAJIK, PANDURANG DEU**

PART NUMBER	DESCRIPTION	QTY	UNIT PRICE	EXTENDED PRICE	CHARGED AMOUNT	WTY*
CUST LABOR	OUT OF WARRANTY CHARGE	360	1.92	690.00	690.00	
R8U2AA8046VB	PC BOARD W/COMPONENT	1	5,796.02	5,796.02	5,796.02	NO
R8S7AA8017ZB	CABLE ASSY	3	76.65	229.95	229.95	NO

Panasonic SHOP WARRANTY: All repairs referenced by this Repair Report are warranted as to parts and labor for a period of 12 months from the date of such repair. Used serviceable components may have been used in restoring this unit.

Cost of Labor	690.00
Cost of Material	6,025.97
Total Cost	6,715.97

* WTY CODES NO = Not Covered FOC = SB covers as FOC SHOP = Shop Wty
WARR = Mfg Wty in Effect FIXED = Fixed Price Repair CC = Panasonic Charged