
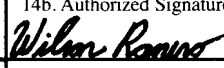
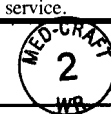


1. Approving Civil Aviation Authority/Country FAA/United States	2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG	3. Form Tracking Number: 136239
--	---	---

4. ORGANIZATION: Name and Address  Med-Craft, Inc.	2450 N.W. 110th Avenue Miami, Florida 33172 Tel.: (305) 594-7444 Fax: (305) 594-9080 F.A.A. Repair Station N° LZ4R354M	5. Work Order / Contract / Invoice Number: TM-R322209
---	--	---

6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status/Work:
1.	Hydraulic Fuse	6271-1	1	2977	REPAIRED

12. Remarks:
Work Order 136239 prescribing the actual work performed is attached. Certifies that the work specified in block 11/12 was carried out in accordance with EASA Part-145 and in respect to that work the component is considered ready for release to service under EASA Part-145 Approval Number: EASA.145.4663. The work stated in Block 11 was accomplished IAW CMM 32-40-04 Rev Date: 12/10/04 Rev No.: 1

13a. Certifies the items mentioned above were manufactured in conformity to: *** <input checked="" type="checkbox"/> Approved design data and are in a condition for safe operation *** *** <input type="checkbox"/> Non-approved design data specified in Block 12. *** *****	14a. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input type="checkbox"/> Other regulations specified in Block 12 Certified that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.	
13b. Authorized Signature: *****	14b. Authorized Signature:  	14c. Approval/Certificate Number: LZ4R354M
13c. Approval/Authorization No.: *****	14d. Name (Typed or Printed): WILSON ROMERO	14e. Date (dd/mm/yyyy): 10 AUG 2017

User/Installer Responsibilities	
It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.	
Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in block 1.	
Statements in Block 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.	

WORK ORDER

Work Order :136239
Part Number :6271-1
Serial Number :2977
ATA Number :32-40-04
Service Req. :Test

Repair Order :TM-R322209
Description :Hydraulic Fuse
Manufacturer :Pneudraulics
Revision Date :12/10/04
Date :07/13/17

FAA REPAIR STATION LZ4R354M

PRELIMINARY VISUAL INSPECTION

VISUAL INSPECTION APPEARS NORMAL

HIDDEN DAMAGE INSPECTION

N/A

Receiving Clerk: Giovanni Acosta DATE: 07/13/2017

CONDITION REPORTED

Time expired.

REMARKS

NONE

AD NOTES, Customer Specs

THERE ARE NO A.D. NOTES FOR THIS UNIT

Verified by: Wilson Ramos DATE: 07/13/2017



WORK ORDER

Work Order :136239
Part Number :6271-1
Serial Number :2977
ATA Number :32-40-04
Service Req. :Test

Repair Order :TM-R322209
Description :Hydraulic Fuse
Manufacturer :Pneudraulics
Revision Date :12/10/04
Date :07/13/17

FAA REPAIR STATION LZ4R354M

PRELIMINARY FUNCTIONAL TEST/TEARDOWN REPORT

*Pretest

Upon pretest found:


1. Volumetric capacity is below allowable limits.

*Disassembly

Upon disassembly and inspection, the following discrepancies were found:

1. Set and compressed packings.
2. Deteriorated seals.
3. Slide binding to sleeve.
4. Unit will be repaired.

TECHNICIAN: Leopoldo Nunez SUPERVISOR: _____

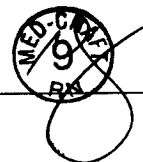

WORK ORDER

Work Order :136239
Part Number :6271-1
Serial Number :2977
ATA Number :32-40-04
Service Req. :Test


Repair Order :TM-R322209
Description :Hydraulic Fuse
Manufacturer :Pneudraulics
Revision Date :12/10/04
Date :07/13/17

FAA REPAIR STATION LZ4R354M

CORRECTIVE ACTION

1. All worn and damaged parts were replaced.
2. Unit was reassembled and tested in accordance with the manufacturer's specifications.
3. Unit passed all functional tests.

Unit repaired and certified for return to service.

Tech : Michael O'Hara Spvsr :  Date : 08/09/17

SERVICE PERFORMED

Repaired

FINAL INSPECTION/RETURN TO SERVICE

Issued with respect to job performed as checked above.
The component identified above was inspected in accordance with current regulations of the F.A.A. and is approved for return to service. Pertinent details of the repair are on file at this agency under

W.O.# 136239 Date 10 AUG 2017 Signed William Ramos 