1. Approving Civil Aviation Authority/Country Transport Canada	AUTHORIZED RELEASE	E CERTIFICATE	3. Form Tracking Number. WO140017
4. Organization Name and Address.		· · · · · · · · · · · · · · · · · · ·	
AJW Technique Inc 7055, rue Alexander Fleming Saint-I aurent OC H45-2R7		Witechnique	5. Work Order, Contract or Invoice Number: W51871
Canada		THE PROPERTY OF THE PROPERTY O	
6. Item: 7. Description:	8. Part Number:	9. Quantity: 10. Serial/Batch Number:	r: 11. Status/Work:
1 Cabin Handset	89-01-07122	1.00 161173	REPAIRED
12. REMARKS REPAIRED AND TESTED SERVICEABLE IN ACCORDANCE WITH CMM 23-73-01 REV 20 DATED SEP 20, 2018. FOR ADDITIONAL INFORMATION SEE TEAR DOWN/INSPECTION REPORT.	ORDANCE WITH CMM 23-73-01 REV 2 WNVINSPECTION REPORT.	20 DATED SEP 20, 2018.	
13a Contines the items identified above were manufacture		-	Maintenance performed in accordance with FAR 43.17
13a. Certifies the items identified above were manufactured in conformity to: Approved design data and are in a condition for safe operation.	ed in conformity to: fe operation.	14a. Certifies that, except where otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was performed in accordance with Canadian Aviation Regulations.	d in Block 12, the work identified in Block n accordance with Canadian Aviation
Non-approved design data specified in Block 12		X CAR 571.10 Maintenance Release	
		■ Other regulation specified in Block 12	
13b. Signature:	13c. Approved Organization Number	14b. Signature	14c. Approval Organization Number 33-12
13d. Name (Typed or Printed): 13e. Date		14d. Name (Typed or Printed)	14e. Date (dd/mmm/yyyy)
		Marc-Andre Campeau	14/Jul/2023
	Installer Res	Installer Responsibilities	
This certificate does not constitute authority to install the part. Installers working in accordance with the national regulations of a country other than specified in Block 1, must ensure that their reg	art. ons of a country other than specified in E	Block 1, must ensure that their regulations recognize certifications from the	iffications from the
country specified. Statements in blocks 13a or 14a do not constitute installation certification. In all cases, the technical record for the aircraft must contain an installation certification issued in accordance with the applicable national regulations before the aircraft may be flown.	tion certification. In all cases,the technicationn.	al record for the aircraft must contain an installation certi	fication issued in accordance with the

AJW.TECHNIQUE

100-7055 Alexander-Fleming, Saint-Laurent, QC, H4S 2B7, Canada www.ajw-group.com

Tear Down/Inspection Report

Work Order: WO140017 Date Printed: 7/14/2023 Customer RO: W51871

Page: 1

To:

A J Walter Aviation Ltd.
THE HEADQUARTERS
MAYDWELL AVENUE
SLINFOLD, WEST SUSSEX RH13 0AS
UNITED KINGDOM

Code: AJW01

Fax:

Descr: Cabin Handset

Phone: +44 1403 798000

P/N: 89-01-07122

22

S/N: 161173

Qty: 1

Mfg: HOLMBERG GMBH

Email: louise@ajw-group.com
TSN: UNK TS

TSO: UNK

TSR: UNK

CSN: UNK

CSO: UNK

CSR:

UNK

P/N Out: 89-01-07122

S/N Out: 161173

Symptoms:

CODE:

REASON FOR REMOVAL

DETAILS:

INOP. Cabin intercom function. WARRANTY

CODE: DETAILS:

Consider for warranty.

Faults:

CODE:

CUSTOMER REASON FOR REMOVAL CONFIRMATION

DETAILS:

Reason for removal is confirmed.

CODE:

WARRANTY REQUESTED

DETAILS:

Warranty requested is: Denied

CODE:

first time AJW-Technique

INITIAL TEST FAILURE

DETAILS:

Initial test failure is attributed to failed testing of the dialing function and failed the testing of the dial tone frequency.

CODE:

DISASSEMBLY / INSPECTION FINDINGS

DETAILS:

During disassembly and inspection of the unit the following anomalies were found: PCB was not well screw in making a gap

between the switch and the buttons of the DTMF. no defective parts founded

CODE:

REPAIR

DETAILS:

The following repair(s) will be performed: The unit will be disassemble for deep inspection

reassemble by CMM spec. adjust clearance switch Unit will be cleaned. Final test required.

Corrective Actions:

CODE:

REPAIRED

DETAILS:

The following repairs has been performed: All parts listed below has been replaced. Unit has been cleaned. Tested serviceable

in accordance with CMM 23-73-01 REV 20 DATED SEP 20, 2018.

TECHNIQUE

100-7055 Alexander-Fleming, Saint-Laurent, QC, H4S 2B7, Canada www.ajw-group.com

WO Packing Slip

WO #: WO140017

Date: 7/14/2023

Time: 10:06:39 AM

Cust Ref #:W51871

SM #: SH163899



To:

A J Walter Aviation Ltd. THE HEADQUARTERS MAYDWELL AVENUE SLINFOLD, WEST SUSSEX RH13 0AS UNITED KINGDOM

Ship To:

B AND H WORLDWIDE INC DORAL 1523 NW 82nd Avenue DORAL, FL 33126

Order Date: 3/30/2023

Ship Via:

EXPEDITOR

Ship Via Acc:

Prepared By: SYSDBA Customer #: AJW01 Buyer:

Part Number/Description	Qty		
89-01-07122 Cabin Handset			
Loc/Whse:	1		
Serial #: 161173			
Genal W. 101110			
		•	
		,	
			•