

1. Approving Competent Authority / Country: European Aviation Safety Agency		2		AUTHORISED RELEASE CERTIFICATE EASA FORM 1		3. Form Tracking Number: D 2097638	
4. Organisation Name and Address: Panasonic Panasonic Avionics Corporation Dubai Airport Free Zone (DAFZ), PO Box 54340, Dubai UAE Telephone: + 971 (0) 4 212 3100. Fax: + 971 (0) 4 299 5652				5. Work Order/Contract/Invoice RO-002164-2013			
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status / Work		
1	TAPPING UNIT	RD-AA5101-10	1	C552243	MODIFIED		
12. Remarks REPLACED TUNER WHICH INCORPORATES MOD 18 IAW SB RDAA5101-23-006 REV. 0 DTD. JUN. 2008. EMBODIED MOD 19 IAW SB RDAA5101-23-007 REV. 0 DTD. JAN. 2009. EMBODIED MOD 20 IAW SB RDAA5101-23-007 DTD. JUN. 2009. UNIT REPAIRED, CHECKED AND INSPECTED IAW CMM 23-32-53 REV. 15 DTD. JUN. 2009.							
Panasonic Avionics Corporation internal reference SR 3302532							
13a. Certifies the items identified above were manufactured in conformity to: ☒ approved design data and are in a condition for safe operation. ☐ non-approved design data specified in block 12.				14a. ☒ PART 145.A.50 Release to Service ☐ Other regulation specified in block 12 Certifies that unless otherwise specified in Block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.			
13b. Authorised Signature		13c. Approval/Authorisation Number		14b. Authorised Signature: 		14c. Certificate/Approval Ref No: EASA 145.0480	
13d. Name		13e. Date (dd mmm yyyy)		14d. Name John Salvana		14e. Date (dd mmm yyyy) 21-SEP-2013	
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification, i.e. all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.							

**Panasonic Avionics Corporation**

Dubai Repair Station

PO Box 54340, Dubai Airport Free Zone, Dubai, UAE

Tel: +971 4 2123100 Fax: +971 4 2995652

REPAIR REPORT / DELIVERY ORDER

SOLD TO YEMEN AIRWAYS
FINANCE DEPARTMENT
GENERAL ACCOUNT
PO BOX 10600
SANA'A, REPUBLIC OF YEMEN , YE

SHIP TO YEMEN AIRWAYS
DIRECTOR MATERIAL
YEMEN AIRWAYS
PO BOX 10600
SAANN, , YE

PAGE 1 of 1

SHIP TRANSACTION:

CUSTOMER P.O. NUMBER RO-002164-2013		CUSTOMER 1416	TAIL NO. 70-ADT	CUST PROD REF 3484452	SERVICE REQUEST 3302532	
PART NUMBER RD-AA5101-10	NOMENCLATURE TAPPING UNIT			DATE REMOVED 22-JUN-2013	DATE RECEIVED 25-JUL-2013	
SERIAL NUMBER C552243	DATE OF MFG 30-APR-2004	WTY START DATE 30-MAY-2004	WTY END DATE 30-MAY-2007	DATE REPAIRED 18-SEP-2013	SHIP DATE	
MOD IN 1-14						
REASON FOR CUSTOMER REJECTION	NO SIGNAL.					
INTERNAL INSPECTION	No Physical Damage DUSTY.					
EXTERNAL INSPECTION	No Physical Damage DUSTY.					
ACTUAL FAILURE / CORRECTIVE ACTION	TESTED - REPORTED FAILURE CONFIRMED. FOUND UNIT FAILED ON VIDEO TEST - TUNER CARD ASSY. DEFECTIVE. REPLACED TUNER WHICH INCORPORATES MOD 18 IAW SB RDAA5101-23-006 REV. 0 DTD. JUN. 2008. EMBODIED MOD 19 IAW SB RDAA5101-23-007 REV. 0 DTD. JUN. 2009. EMBODIED MOD 20 IAW SB RDAA5101-23-007 DTD. JUN. 2009. UNIT REPAIRED, CHECKED AND INSPECTED IAW CMM 23-32-53 REV. DTD. JUN. 2009.					

MOD OUT: 1-14,18-20

INSPECTED BY: John Salvana

REPAIRED BY: BRANTHA, MAAS

PART NUMBER	DESCRIPTION	QTY	UNIT PRICE	EXTENDED PRICE	CHARGED AMOUNT	WTY*
CUST LABOR	OUT OF WARRANTY CHARGE	365	1.92	699.58	699.58	
R8U5AA5101Y	PC BOARD W/COMPONENT	1	590.54	590.54	590.54	NO
R7WMA3G03AZ	WIRE ASSY	1	0.79	0.79	0.79	NO
R7APA810	GLUE	0	16.51	0.33	0.33	NO
R7AKE3494	SILICON GLUE	0	167.02	3.34	3.34	NO

Panasonic SHOP WARRANTY: All repairs referenced by this Repair Report are warranted as to parts and labor for a period of 12 months from the date of such repair. Used serviceable components may have been used in restoring this unit.

* WTY CODES NO = Not Covered FOC = SB covers as FOC SHOP = Shop Wty
WARR = Mfg Wty in Effect FIXED = Fixed Price Repair CC = Panasonic Charged

Cost of Labor	699.58
Cost of Material	595.00
Total Cost	1,294.58