

1. Approving Competent Authority/Country CAA-NL / THE NETHERLANDS		2. AUTHORISED RELEASE CERTIFICATE EASA FORM 1			3. Form Tracking Number 1316001831	
4. Approved Organisation Name and Address : Fokker Services B.V. Hoeksteen 40 2132 MS Hoofddorp THE NETHERLANDS		Location Oude Meer			5. Work Order/ Contract/ Invoice R286501	
6. Item	7. Description	8. Part No	9. Quantity	10. Serial No	11. Status/Work	
1	MMR CONTROL PANEL	G7505-01	1 EA	67	MODIFIED	
12. Remarks USED MAINTENANCE DATA: ATP A46704-01 REV/17 DATED 07-OCT 2013 DWG D46605 REV.15 DATED 08-JUL 2013 PART LIST G7505-01 REV.18 DATED 16-MAR 2009 SB G7505-01-34-06 REV.00 DATED 02-JUL 2013 DWG B46616A REV.07 DATED 08-JUL 2013 PART LIST 700B46616A REV.09 DATED 10-OCT 2013 MOD STATUS : A-D,H-J TCCA Approval No.: 813-33 - Accompanying shopfinding report is part of this EASA Form 1 - The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to that work, the items are approved for return to service under certificate no. NQ1Y357K. Pertinent details of the repair are on file at this repair station under the order number referenced in block 3.						
13a. Certifies that the items identified above were manufactured in conformity to: ☐ approved design data and are in condition for safe operation ☒ non-approved design data specified in block 12		14a. ☒ Part-145, A.50 Release to Service ☒ Other regulation specified in Block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.				
13b. Authorised Signature		13c. Approval/ Authorisation Number		14b. Authorised Signature		14c. Certificate/ Approval Ref. No
				 RONALD SCHOON FOKKER A 02232 SERVICES		NL.145.1174
13d. Name		13e. Date (dd MMM yyyy)		14d. Name		14e. Date (dd MMM yyyy)
				Ronald Schoon		07 MAR 2016

USER/INSTALLER RESPONSIBILITIES

This certificate does not automatically constitute authority to install the item(s).

Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1.

Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.



Fokker Services B.V.

Hoeksteen 40
2132 MS Hoofddorp
THE NETHERLANDS

Location Oude Meer

Internet: www.fokkerservices.com

Shop Finding Report

Page : 1 of 3

Delivery :

AJW AVIATION
Attn: ANDREW HONEYSETT
MAYDWELL AVENUE, SLINFOLD
THE HEADQUARTERS,
RH13 0SH WEST SUSSEX
UNITED KINGDOM
Tel. : 1403712141
Fax : 1403712135

For Customer : AJW AVIATION
S.O. No. : 2516005392

Line No. :

Cust P.O. : R286501	P/N : G7505-01	Batch/Lot :
Our Ref# :	Desc : MMR CONTROL PANEL	Cust.Ref :
Contract # :	S/N : 67	Work Perf. :
Vend Ref # :	MFG : GABLES ENGINEERING INC	Manual :
Project # : 5N-BQS	Qty : 1.00000 Cond As: SV	Revision :
Completed P/N : G7505-01	S/N As : 67	Into Bin Loc :
Company : 1	Division : 12	Department : 2500
Order Date : Mar-01-2016	Received Date : Mar-01-2016	Due Date : Mar-12-2016
		Print Date : Mar-07-2016

WORK ORDER No. 1316001831

Reported By Customer

XFR SW STUCK

PLEASE EMBODY SB G7505-01-34-06 FOC

PLEASE REPAIR UNDER FIXED PRICE.
NO CONFIGURATION ALTERATION WITHOUT PRIOR APPROVAL
"NO PMA ALLOWED WITHOUT PRIOR CONSENT".

Receiving Condition

UPON RECEIPT NO VISUAL DAMAGE

Inspection

=DURING PRELIMINARY INSPECTION FOUND:
- FRONTPLASTIC CRACKED ABOVE WINDOW GLASS

=DURING FUNCTIONAL TEST FOUND:
- REASON FOR REMOVAL CONFIRMED TFR BUTTON AND SEVERAL OTHER PUSHBUTTONS HARD TO OPERATE .
TO IMPROVE SWITCH OPERATION SB G7505-01-34-06 (MOD.J) TO BE INCORPORATED.

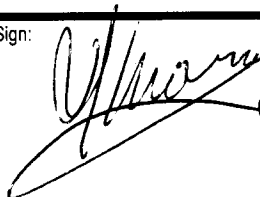
Name:

R.G. Schoon

Date:

07 MAR 2016

Sign:


FOKKER
A
02232
SERVICES

Continued on next page...



GKN AEROSPACE

Fokker Services B.V.

Hoeksteen 40
2132 MS Hoofddorp
THE NETHERLANDS

Location Oude Meer

Internet: www.fokkerservices.com

Shop Finding Report

Page : 2 of 3

WORK ORDER No. 1316001831

=REASON FOR QUOTE: QUOTE REQUIREMENT / NNWT

=USED INTERNAL INSTRUCTION:

AWI: A-02295 REV.12

=USED MAINTENANCE DATA:

ATP A46704-01 REV.17 DATED 07-OCT 2013

DWG D46605 REV.15 DATED 08-JUL 2013

PART LIST G7505-01 REV.118 DATED 16-MAR 2009

SB G7505-01-34-06 REV.00 DATED 02-JUL 2013

DWG B46616A REV.07 DATED 08-JUL 2013

PART LIST 700B46616A REV.09 DATED 10-OCT 2013

Action Taken

=REPLACED:

- FRONTPLASTIC INCLUDING WINDOW GLASS.

=REPAIR:

- CLEANED PUSH BUTTONS.

=MODIFY:

- INCORPORATED SB G7505-01-34-06 (MOD.J)

MOD STATUS BECOMES : A-D,H-J.

UNIT PASSED FINAL TEST.

Item	Part Number / Description	Part Status	Qty	Cond	Discrepancy / Disposition
PARTS & MATERIALS					
5	600A45074G KEY PLUNGER (AUTO/MAN SWITCH)	32 - Installed Component	1	EA NE	Disc. : MODIFICATION Disp. : _____
2	600A47764A KEY, PLUNGER / ADAPTER	32 - Installed Component	15	EA NE	Disc. : MODIFICATION Disp. : _____
3	600B46814 LIGHT LEAK GASKET	32 - Installed Component	1	EA NE	Disc. : MODIFICATION Disp. : _____
1	701-0946-23 BD/ASSY, LIGHTING / DOME ARRAY	32 - Installed Component	1	EA NE	Disc. : MODIFICATION Disp. : _____
6	600B46613	32 - Installed Component	1	EA NE	Disc. : NOT NORMAL WEAR & TEAR

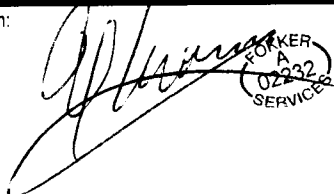
Name:

R. G. Simon

Date:

07 MAR 2016

Sign:


FOKKER
A-02295
SERVICE

Continued on next page...



GKN AEROSPACE

Fokker Services B.V.

Hoeksteen 40
2132 MS Hoofddorp
THE NETHERLANDS

Location Oude Meer

Internet: www.fokkerservices.com

Shop Finding Report

Page : 3 of 3

WORK ORDER No. 1316001831

FRONT PLASTIC G7505-01 GRAY

Disp. : _____

Name:

R.G. Snoen

Date:

07 Mar 2016

Sign:

[Signature]

