

1. Approving Competent Authority / Country: United Kingdom Civil Aviation Authority		2 AUTHORISED RELEASE CERTIFICATE EASA FORM 1				3. Form Tracking Number: L 3369019	
4. Organization Name and Address: Panasonic		Panasonic Avionics Corporation Quadrant House, Heron Drive, Parlaunt Road, Langley, Berks, SL3 8XP, UK				5. Work Order/Contract/Invoice T32655	
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No	11. Status / Work		
1	BROADBAND CONTROLLER	RD-NB2500-01	1	G304966	REPAIRED		
12. Remarks ALL WORK HAS BEEN CARRIED OUT AND LRU CONFORMED IAW CMM 44-28-84 REV 13 DTD NOV 17. PLEASE REFER TO SR NUMBER 5439608.							
<p>Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service. UZVY163X. In accordance with TCCA Approval 808-03.</p> <p>Panasonic Avionics Corporation internal reference SR5439608</p>							
13a. Certifies the items identified above were manufactured in conformity to:		14a. <input checked="" type="checkbox"/> PART 145.A.50 Release to Service <input checked="" type="checkbox"/> Other regulation specified in block 12					
<input type="checkbox"/> approved design data and are in a condition for safe operation. <input type="checkbox"/> non-approved design data specified in block 12.		Certifies that unless otherwise specified in Block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.					
13b. Authorised Signature:	13c. Approval/Authorisation Number		14b. Authorised Signature:		14c. Certificate/Approval Ref No:		
13d. Name	13e. Date (dd mmm yyyy)		14d. Name		14e. Date (dd mmm yyyy)		
			Mick White		UK.145.00297 20-JUN-2019		
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.							


**Panasonic Avionics Corporation**

Quadrant House, Heron Drive, Parlaunt Road,
Langley Berks, SL3 8XP, UK.
Tel: +44(0) 1753 741450 Fax: +44(0) 1753 741481

REPAIR REPORT / DELIVERY ORDER

SOLD TO **AJ WALTER AVIATION**
THE HEADQUARTERS
MAYDWELL AVENUE
SLINFOLD, ENGLAND RH13 0AS, GB

SHIP TO **AJ WALTER AVIATION**
THE HEADQUARTERS
MAYDWELL AVENUE
SLINFOLD, ENGLAND RH13 0AS, GB

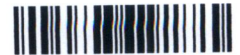

PAGE 1 of 1

SHIP TRANSACTION:

CUSTOMER P.O. NUMBER T32655		CUSTOMER 1001	TAIL NO. A6-LRC	CUST PROD REF 11585421	SERVICE REQUEST 5439608
PART NUMBER RD-NB2500-01	NOMENCLATURE BROADBAND CONTROLLER			DATE REMOVED	DATE RECEIVED 09-MAY-2019
SERIAL NUMBER G304966	DATE OF MFG 30-NOV-2014	WTY START DATE 27-FEB-2015	WTY END DATE 26-AUG-2020	DATE REPAIRED 20-JUN-2019	SHIP DATE
MOD IN 1-7,10,11					
REASON FOR CUSTOMER REJECTION	PLEASE QUOTE TO TEST / RECERT. REMOVED SERVICABLE.				
INTERNAL INSPECTION	No Physical Damage - DIRTY. MODEM BOARD SERIAL NUMBER IS:141029				
EXTERNAL INSPECTION	No Physical Damage - DIRTY. WARRANTY LABEL INTACT.				
ACTUAL FAILURE / CORRECTIVE ACTION	UNIT TESTED AND FAILED SMARTCARD TEST. CONFIRMED CUSTOMER COMPLAINT. REMOVED SMARTCARD, CLEANED SMART CARD AND PIN CONTACTS IN J24 CONNETOR. REPLACED SMARTCARD AND ADD HOT GLUE TO SECURED IN PLACE ON THE MICROPROCESOR BOARD. UNIT DISASSEMBLED AND CLEANED. UNIT HAD MODEM SOFTWARE VERSION 13.0.0.3.6 PREVIOUSLY EMBODIED. FANS ARE OVER FOUR YEARS OLD. REPLACED NUTS AND BOTH FANS IAW SB RDNB2500-01-44-14 REV 0 DTD OCT 2017. UNIT CLEANED TESTED AND PASSED ALL WORK HAS BEEN CARRIED OUT AND LRU CONFORMED IAW CMM 44-28-84 REV 13 DTD NOV 17.				

MOD OUT: 1-7,10,11

INSPECTED BY: **Mick White**REPAIRED BY: **Douglas, Louie**

PART NUMBER	DESCRIPTION	QTY	UNIT PRICE	EXTENDED PRICE	CHARGED AMOUNT	WTY*
WTY LABOR	IN-WARRANTY; NO CHARGE	420	0.00	0.00	0.00	
R7APA810	HOT MELT ADHESIVES	1	18.29	18.29	0.00 WARR	
MO60000010	FAN, 40mm x 40mm x 6.5mm	2	44.98	89.96		
R6HT12ZA1	HARDWARE, NUT, INSERT	4	1.17	4.68		

Panasonic SHOP WARRANTY: All repairs referenced by this Repair Report are warranted as to parts and labor for a period of 12 months from the date of such repair. Used serviceable components may have been used in restoring this unit.

* WTY CODES NO = Not Covered FOC = SB covers as FOC SHOP = Shop Wty
WARR = Mfg Wty in Effect FIXED = Fixed Price Repair CC = Panasonic Charged