


1. Approving Competent Authority / Country CAA / UNITED KINGDOM		2. AUTHORISED RELEASE CERTIFICATE CAA FORM 1			3. Form Tracking Number 0001005383	
4. Organisation Name and Address: SAFRAN AEROSYSTEMS SERVICES UK Ltd UNIT 610, AVENUE WEST, SKYLINE 120 BRAINTREE, ESSEX, CM77 7AA, ENGLAND UNITED KINGDOM		5. Work Order / Contract / Invoice 0051136417 W53044				
6. Item		7. Description		8. Part No	9. Qty.	10. Serial No.
1		REGULATOR, CREW OXYGEN MASK		MC10-08-109	1	79992
11. Status / Work REPAIRED						
12. Remarks Repaired and tested IAW CMM: 35-13-63 REV 18, CMM: 35-13-74 REV 5, CMM: 35-13-72 REV 9, CMM: 35-13-71 REV 11 Harness Inspected IAW AD:2011-0090R1 Rev 1 (SB:MXH 35-240 Rev 7) & AD:2015-08-07 (SB:MXH 35-241 Rev 3) S/N: 79992 not found in Appendix 1 in accordance with MCF-SBU-35-001 REV: 1 and passed all tests. Parts Replaced: Microphone capsule, Overpressure capsule Previous overhaul: 04/2023 Next overhaul due: 04/2029 SEE REPAIR REPORT No: 0000996385						
The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR Part 43 and in respect to that work, the items are approved for return to service under FAA certificate no Z5KY074B						
14a. ☒ Part-145 A.50 Release to Service ☒ Other regulation specified in block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.						
14b. Authorised Signature 				14c. Certificate / Approval Ref. No. UK.145.01053		
14d. Name Matthew West				14e. Date (dd mmm yyyy) 27 Nov 2023		
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.						

1. Approving Competent Authority / Country EASA		2. AUTHORISED RELEASE CERTIFICATE EASA FORM 1				3. Form Tracking Number 0000996385	
4. Organisation Name and Address: SAFRAN AEROSYSTEMS SERVICES UK LTD UNIT 610, AVENUE WEST, SKYLINE 120 BRAINTREE, ESSEX, CM77 7AA, ENGLAND UNITED KINGDOM		5. Work Order / Contract / Invoice 0051136417 W53044		11. Status / Work REPAIRED			
6. Item	7. Description	8. Part No	9. Qty.	10. Serial No.			
1	REGULATOR, CREW OXYGEN MASK	MC10-08-109	1	79992			
12. Remarks Repaired and tested IAW CMM: 35-13-63 REV 18, CMM: 35-13-74 REV 5, CMM: 35-13-72 REV 9, CMM: 35-13-71 REV 11 Harness inspected IAW AD:2011-0090R1 Rev 1 (SB:MXH 35-240 Rev 7) & AD:2015-08-07 (SB:MXH 35-241 Rev 3) S/N: 79992 not found in Appendix 1 in accordance with MCF-SBU-35-001 REV: 1 and passed all tests. Parts Replaced: Microphone capsule, Overpressure capsule Previous overhaul: 04/2023 Next overhaul due: 04/2029 SEE REPAIR REPORT No: 0000996385							
13a. Certifies that the items identified above were manufactured in conformity to: ☒ approved design data and are in a condition for safe operation ☒ non-approved design data specified in block 12		14a. ☒ Part-145 A.50 Release to Service ☐ Other regulation specified in block 12		14b. Authorised Signature 			
13b. Authorised Signature		13c. Approval / Authorisation Number		14c. Certificate / Approval Ref. No. EASA.UK.145.01053			
13d. Name		13e. Date (dd mmm yyyy)		14d. Name Matthew West			
13f. Date (dd mmm yyyy)		13g. Date (dd mmm yyyy)		14e. Date (dd mmm yyyy) 27 Nov 2023			
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.							

SAFRAN AEROSYSTEMS SERVICES UK LTD REPAIR REPORT

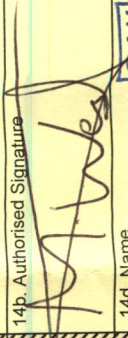

No 0000996385

REPAIRED

CUSTOMER: AJ WALTER AVIATION LTD

ORDER No: 1114740 / 0051136417

CUSTOMER ORDER: W53044

RECEIVED DATE: 17-10-23

CUSTOMER INSTRUCTION: CUSTOMER REQUEST

RECEIVING

DESCRIPTION: REGULATOR, CREW OXYGEN MASK

REF AIRCRAFT MANUFACTURER:

RECEIVED PART NUMBER: MC10-08-109

MANUFACTURER: INT221 SAFRAN AEROSYSTEMS D4

SERIAL NUMBER: 79992

CAGE CODE: F5341

AMENDMENT: A L M N P T

MANUFACTURING DATE: 01-11-99

QUANTITY: 1

REMOVAL DATE: 18/09/2023

LAST OHL DATE 04/2023

TSN:

TSO:

TSR:

AIRCRAFT:	REGISTRATION NUMBER:	A/C DELIVERY DATE:
N/K	N245AC	N/K

Maintenance Documentation Reference

35-13-63 Rev: 18
35-13-74 Rev: 5
35-13-72 Rev: 9
35-13-71 Rev: 11

Reason for Removal

Overhaul

Findings

Overhaul requested
Repair required
Reported fault: Intermittent Mic operation
Failed Test: Automatic pressure breathing
Microphone not working

SHIPPING

SHIPPED PART NUMBER: MC10-08-109

REF AIRCRAFT MANUFACTURER: MC10-08-109

SERIAL NUMBER: 79992

AMENDMENT : A L M N P T

DATE: 27-11-23
(DD-MM-YY)

TECHNICIAN:

Signature

INSPECTOR: Workshop ZAU

Signature



SAFRAN AEROSYSTEMS SERVICES UK LTD
REPAIR REPORT



No 0000996385

REPAIRED

CUSTOMER: AJ WALTER AVIATION LTD

ORDER No: 1114740 / 0051136417

CUSTOMER ORDER: W53044

RECEIVED DATE: 17-10-23

CUSTOMER INSTRUCTION: CUSTOMER REQUEST

Work performed & replaced parts /Travaux réalisés & pièces remplacées

Fault confirmed.

Repaired and tested IAW relevant CMM's.

Harness inspected IAW AD:2011-0090R1 Rev 1 (SB:MXH 35-240

Rev 7) & AD:2015-08-07 (SB:MXH 35-241 Rev 3)

S/N: 79992 not found in Appendix 1 in accordance with

MCF-SBU-35-001 REV: 1 and passed all tests.

Parts replaced:

Microphone capsule

Overpressure capsule

Remarks

Next overhaul due: 04/2029

Customer liability No

SHIPPING

SHIPPED PART NUMBER: MC10-08-109

REF AIRCRAFT MANUFACTURER: MC10-08-109

SERIAL NUMBER: 79992

AMENDMENT : A L M N P T

DATE: 27-11-23
(DD-MM-YY)

TECHNICIAN:

Signature

INSPECTOR: Workshop ZAU

Signature

