


1. Approving Competent Authority/Country CAA/UK		2. AUTHORISED RELEASE CERTIFICATE CAA FORM 1		3. Form Tracking Number 00000000000010527428 Page 1 of 1	
4. Organisation Name and Address: Goodrich Actuation Systems Stafford Rd, Fordhouses Wolverhampton, West Midlands, WV10 7EH, England				5. Work Order/Contract/Invoice 45692434 R414675	
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
01	FLAP ACTUATOR NO.2	792D0000-01	1	792D000GA050349	REPAIRED
12. Remarks Purpose: Approval for Return to Service RETURNED FOLLOWING: REPAIR AND TEST IN ACCORDANCE WITH CMM 27-53-66 REVISION 6, DATED MAY 7th 2021. TSN: UNKNOWN CSN: UNKNOWN The work identified in block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to that work, the items are approved for return to service under FAA certificate No. LF7Y504J.					
13a. Certifies that the items identified above were manufactured in conformity to: ☐ approved design data and are in a condition for safe operation ☐ non-approved design data specified in block 12			14a. ☒ Part-145.A.50 Release to Service ☐ Other regulation specified in block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part 145 and in respect to that work the items are considered ready for release to service.		
13b. Authorised Signature		13c. Approval / Authorisation Number		14b. Authorised Signature  UTASW 0614	
13d. Name		13e. Date (dd mmm yyyy)		14c. Certificate / Approval Ref. No. UK.145.00860	
				14d. Name MATTHEW WHEAT	
				14e. Date (dd mmm yyyy) 21 AUG 2023	
USER / INSTALLER RESPONSIBILITIES					
This certificate does not automatically constitute authority to install the item(s).					
Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1.					
Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					

1. Approving Competent Authority/Country EASA		2. AUTHORISED RELEASE CERTIFICATE EASA FORM 1		3. Form Tracking Number 00000000000010527424 Page 1 of 1	
4. Organisation Name and Address: Goodrich Actuation Systems Stafford Rd, Fordhouses Wolverhampton, West Midlands, WV10 7EH, England				5. Work Order/Contract/Invoice 45692434 R414675	
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work
01	FLAP ACTUATOR NO.2	792D0000-01	1	792D000GA050349	REPAIRED
12. Remarks Purpose: Approval for Return to Service RETURNED FOLLOWING: REPAIR AND TEST IN ACCORDANCE WITH CMM 27-53-66 REVISION 6, DATED MAY 7th 2021. TSN: UNKNOWN CSN: UNKNOWN					
13a. Certifies that the items identified above were manufactured in conformity to: ☐ approved design data and are in a condition for safe operation ☐ non-approved design data specified in block 12			14a. ☒ Part-145.A.50 Release to Service ☐ Other regulation specified in block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part 145 and in respect to that work the items are considered ready for release to service.		
13b. Authorised Signature		13c. Approval / Authorisation Number		14b. Authorised Signature	
13d. Name		13e. Date (dd mmm yyyy)		14c. Certificate / Approval Ref. No. EASA.UK.145.00860	
				14d. Name MATTHEW WHEAT	
				14e. Date (dd mmm yyyy) 21 AUG 2023	
USER / INSTALLER RESPONSIBILITIES					
This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					

TEARDOWN REPORT

Goodrich Actuation Systems Ltd.
Stafford Road
WOLVERHAMPTON
WV10 7EH
UNITED KINGDOM
Repair Station #LF7Y504J

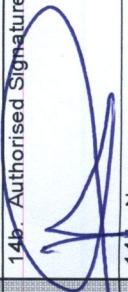

UTC Aerospace Systems

Customer A J WALTER AVIATION		Cust PO	R414675	Operator PO	
Input Part	792D0000-01	Input Serial	792D000GA050349	Qty	1.000
Output Part	792D0000-01	Output Serial	792D000GA050349	Workscope	REPAIR
Cust Part		Cust Serial	792D000GA050349	Status/Work	REPAIRED
Description	FLAP ACTUATOR NO.2	Removal Code	UNRE Test and repair	Failure Date	
Aircraft		Engine Type			
Incoming NSN	N/A	Outgoing NSN	N/A	Tail No	OM-BYA
Date Rec'd	01.08.2023	Quote Date	07.08.2023	Accept Date	08.08.2023
Ship Date		DOM	01.06.2005	Last Order Date	
Sales Order	120853601	Work Order	45692434	Notification	305305401
Customer Reason for Return Commercial Controller & Customer Req'm's TEST AND REPAIR HEAVY LEAKAGE EASA FORM ONE, CAA UK DUAL, TEARDOWN REQUIRED					
Certification Type EASA FORM ONE, CAA DUAL					
CMM Reference CMM Number and Revision c.M.M.27-53-66 REV 6.					
Preliminary Inspection Receipt Survey Findings UNIT IN A DIRTY CONDITION, TRANSPORT ITEMS MISSING. INPUT SHAFT LEAKING.					
Evaluation Inspection Test As Received (T.A.R) Results NOT APPLICABLE DUE TO INPUT SHAFT LEAKING. ROTARY PASSED BENCH TEST.					
Work Performed Strip Observations SPEEDI SLEEVES WORN ON INPUT SHAFT. SPRING DISCS WORN.					

Goodrich Actuation Systems Ltd.
Stafford Road
WOLVERHAMPTON
WV10 7EH
UNITED KINGDOM
Repair Station #LF7Y504J

TEARDOWN REPORT



UTC Aerospace Systems

Work Order	45692434	Description	FLAP ACTUATOR NO.2	Date Rec'd	01.08.2023
Input Part	792D0000-01	Input Serial	792D000GA050349		
Cust Part		Cust Serial	792D000GA050349		

Administrative Notes

Free Text

UNIT REPAIRED AND TESTED SATISFACTORY.

Components :

Order	Material	Description	Req Qty	Issued	Reason Code	Stor Loc
45692434	796A0200-01	DRIVE SHAFT ASSY.	1	1	WORN	CLAS
45692434	M83461-1-005	O-RING SEAL	1	1	DISSASSEMBLY	REPS
45692434	M83461-1-010	O-RING SEAL	9	9	DISSASSEMBLY	REPS
45692434	M83461-1-012	O-RING SEAL	1	1	DISSASSEMBLY	REPS
45692434	M83461-1-048	O-RING SEAL	1	1	DISSASSEMBLY	REPS
45692434	M83461-1-050	O-RING SEAL	1	1	DISSASSEMBLY	REPS
45692434	CH251360	O-RING SEAL	1	1	DISSASSEMBLY	REPS
45692434	CH251346-04	BEARING	2	2	DISSASSEMBLY	REPS
45692434	CH250494	P.D.R. SHAFT SEAL	2	2	DISSASSEMBLY	REPS
45692434	795-0036	FULCRUM PIN	1	1	DISSASSEMBLY	REPS
45692434	CH250078	SPRING DISC	14	14	WORN	REPS
45692434	CH143561	CAP (TRANSPORTATION)	1	1	MISSING	REPS
45692434	CH143515	LABEL	1	1	MISSING	REPS

Author :
Print name :
Signature:
Date:

NOT APPLICABLE

UTASW 0614

Authorized Approval :
Print name :
Signature:
Date:

MATTHEW WHEAT

21 AUG 2023

UTASW 0614