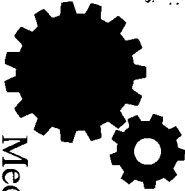
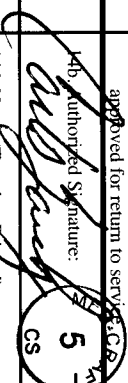


1. Approving Civil Aviation Authority/Country FAA/United States	2.	3. Form Tracking Number: 175031
--	----	---

4. ORGANIZATION: Name and Address  Med-Craft, Inc.	2450 N.W. 110th Avenue Miami, Florida 33172 Tel.: (305) 594-7444 Fax: (305) 594-9080 F.A.A. Repair Station N° LZ4R354M	5. Work Order / Contract / Invoice Number: FP-R415297
---	--	---

6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status/Work:
1.	Elevator Power Control	65-44761-22	1	12712A	OVERHAULED

12. Remarks:
Work Order 175031 prescribing the actual work performed is attached. Certifies that the work specified in block 11/12 was carried out in accordance with EASA Part-145 and in respect to that work the component is considered ready for release to service under EASA Part-145 Approval Number: EASA.145.4663.
The work stated in block 11 was accomplished IAW CMM 27-09-21 Rev Date: 03/01/23 Rev No: 72

13a. ☒ Certified the items identified above were manufactured in conformity with: * * * * * * * * * * ☐ Approved design data applicable to a specific type of aircraft. * * * * * ☐ Non-approved design data specific to Block 12. * * * * *	14a. ☒ 14 CFR 43.9 Return to Service ☒ Other regulations specified in Block 12 Certified that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service. 14b. Authorized Signature:  CS	14c. Approval/Certificate Number: LZ4R354M
13b. Not applicable to this work * * * * *	14d. Name (Typed or Printed): CARLOS SANCHEZ	14e. Date (dd/mm/yyyy): 20 SEP 2023
13c. Not applicable to this work * * * * *	13d. Name (Typed or Printed): * * * * *	13e. Date (dd/mm/yyyy): * * * * *

User/Installer Responsibilities

It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.

Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in block 1.

Statements in Block 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

WORK ORDER

Work Order	: 175031	Repair Order	: FP-R415297
Part Number	: 65-44761-22	Description	: Elevator Power Co
Serial Number	: 12712A	Manufacturer	: Boeing
ATA Number	: 27-09-21	Revision Date	: 03/01/23
Service Req.	: Repair	Date	: 08/08/23

FAA REPAIR STATION LZ4R354M

PRELIMINARY VISUAL INSPECTION

VISUAL INSPECTION APPEARS NORMAL

HIDDEN DAMAGE INSPECTION

N/A

Receiving Clerk: Orlando Sanchez

DATE: 08/08/2023

CONDITION REPORTED

LEAKING


REMARKS

NONE

AD NOTES, Customer Specs

AD NOTES ON FILE:

NO: 2000-02-18 01/24/00

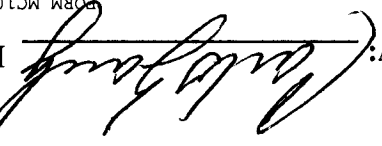Verified by: 
DATE: 20 SEP 2023
FORM MC10-1
REV 16



WORK ORDER

FAA REPAIR STATION LZ4R354M

PRELIMINARY FUNCTIONAL TEST/TEARDOWN REPORT

*Pretest

Upon pretest found:

1. Failed due to external leakage at piston rod seals and input lever.

*Disassembly

Upon disassembly and inspection, the following discrepancies were found:

1. Set and compressed packings.

2. Deteriorated seals.

3. Piston requires in house rework (polishing).

4. Rod end required in house rework (bearing replacement).

5. NDT and Cadmium plating will be performed.

6. Unit fully disassembled, cleaned and inspected in accordance with the

- manufacturer's CMM 27-09-21.

7. Unit will be overhauled.

8. AD 2000-02-18, dated 01/24/2000 is not applicable to unit serial


number.

TECHNICIAN: Christopher Burton

SUPERVISOR:

FORM MC10-2

REV 16



WORK ORDER

Work Order	: 175031	Repair Order	: FP-R415297
Part Number	: 65-44761-22	Description	: Elevator Power Co
Serial Number	: 12712A	Manufacturer	: Boeing
ATA Number	: 27-09-21	Revision Date	: 03/01/23
Service Req.	: Repair	Date	: 08/08/23

FAA REPAIR STATION LZ4R354M

CORRECTIVE ACTION

1. Replaced all worn and damaged parts.
2. NDT and Cadmium plating was performed.
3. Unit fully reassembled and tested in accordance with the manufacturer's CMM.
4. Unit passed all functional tests.

Unit overhauled and certified for return to service.

Tech : Christopher Burton Spvsr :  Date : 20 SEP 2023

SERVICE PERFORMED

Overhauled

FINAL INSPECTION/RETURN TO SERVICE

Issued with respect to job performed as checked above.
The component identified above was inspected in accordance with current regulations of the F.A.A. and is approved for return to service. Pertinent details of the repair are on file at this agency under

W.O.# 175031 Date 20 SEP 2023



Signed