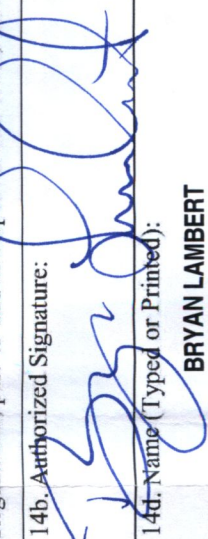


1. Approving Civil Aviation Authority/Country: FAA/United States		2. AUTHORIZED RELEASE CERTIFICATE FAA Form 8130-3, Airworthiness Approval Tag		3. Form Tracking Number: 482634	
4. Organization Name and Address: CURTISS-WRIGHT Curtiss-Wright 3120 Northwest Blvd, Gastonia, NC 28052 USA		FAA YCWR993K EASA.145.4363		5. Work Order/Contract/Invoice Number: R10029601/T30988	
6. Item: 1	7. Description: ACTUATOR	8. Part Number: 256T3210-4	9. Quantity: 1	10. Serial Number: 0916	11. Status/Work: OVERHAULED
12. Remarks: OVERHAULED AND TESTED IAW CMM 27-51-08, REV 35, DATED 11/01/2017. C/W SB 767-27A0229, PART 2, REV ORIG IAW AD 2014-22-09.					
Curtiss-Wright certifies that the work specified in block 11/12 was carried out in accordance with EASA Part 145 and in respect to that work, the aircraft component is considered ready for release under EASA Part 145 Approval Number EASA.145.4363. TSO 000.00 TSR 000.00 TSN UNK CSO 000 CSR 000 CSN UNK					
13a. Certifies the items identified above were manufactured in conformity to: ☐ Approved design data and are in a condition for safe operation. ☐ Non-approved design data specified in Block 12. 13b. Authorized Signature: 13c. Approval/Authorization No.: 13d. Name (Typed or Printed):					
14a. ☒ 14 CFR 43.9 Return to Service ☒ Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service. 14b. Authorized Signature:  14c. Approval/Certificate No.: YCWR993K 14d. Name (Typed or Printed): BRYAN LAMBERT 14e. Date (dd/mm/yyyy): 09/Mar/2018					
User/Installer Responsibilities It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine / propeller / article. Where the user /installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s) / propeller(s) / article(s) from the airworthiness authority of the country specified in Block 1. Statements in Block 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					

1 国家 Country P.R.CHINA	2. 中国民用航空总局 CAAC ☐ 符合性 Conformity ☒ 适航性 Airworthiness	3 证书编号 Certificate Ref. No. 482634				
批准放行证书/适航批准标签 AUTHORIZED RELEASE CERTIFICATE/AIRWORTHINESS APPROVAL TAG						
4 单位 Organization: CURTISS-WRIGHT	CURTISS-WRIGHT 3120 NORTHWEST BLVD. GASTONIA, NC 28052 USA	5 工作单/合同单/货单 Work Order/Contract/Invoice R10029601/T30988				
6 序号 Item	7 内容 Description	8 件号 Part No.	9 适用性 Eligibility	10 数量 Qty	11 系列号/批号 Serial/Batch No.	12 产品状态 Status/Work
1	ACTUATOR	256T3210-4	N/A	1	0916	OVERHAULED
13 备注 Remarks: OVERHAULED AND TESTED IAW CMM 27-51-08, REV 35, DATED 11/01/2017. C/W SB 767-27A0229, PART 2, REV ORIG IAW AD 2014-22-09. TSO: 000.00 TSR: 000.00 TSN: UNK CSO: 000 CSR: 000 CSN: UNK						
14 新产品 New Parts 兹声明上述产品除第 13 项的其它规定以外, 已按照上述国家适航条例进行制造/检查, 并且该 产品 (出口产品) 符合经批准的型号设计资料和进口国提出的专用要求。 Certifies that the Part(s) identified above except as otherwise specified in block 13 was(were) manufactured/inspected in accordance with the airworthiness regulations of the stated country and/or in the case of parts to be exported with the approved design data and with the notified special requirements of the importing country.						
15 使用过的产品 Used Parts		19 中国民航总局授权 Issued by or on behalf of the CAAC F00100105				
16 批准人签名 Signature		18 批准日期 Date 09/Mar/2018				
17 批准人姓名 (打印的) Name (Printed)		BRYAN LAMBERT				

Curtiss-Wright
3120 Northwest Blvd
GASTONIA NC 28052
704-869-2300 Fax 704-869-2326

FAA CRS No : YCWR993K
Work Order : R10029601

Customer : A.J. WALTER AVIATION LTD

CSN: UNK

CSO: 000

CSR: 000

Cust Order: T30988

TSN: UNK

TSO: 000.00

TSR: 000.00

Outgoing : 256T3210-4

ACTUATOR

S/N: 0916

Incoming P/N : 256T3210-4

Date Estimated: 03-11-2018

Incoming S/N : 0916

Incoming Work Req: REP

Outgoing Work Req: OVH

Technical Manual : 27-51-08

Rev: 35

Rev Date: 11-01-2017

Reason/Rm:

INSPECT AND REPAIR IF FAIL.

Preliminary Inspection:

Date: 02-14-2018

Inspector: BRYAN SPANGLER

RECEIVED IN POOR CONDITION. FAILED RECEIVING INSPECTION FOR CORROSION. UNIT IS

COMPLETE WITH EXTRA PART ATTACHED: OFFSET TEE GEARBOX ASSEMBLY, P/N: 256T3540-4

S/N:AVL092

C/W SB 767-27A0229, PER AD 2014-22-09.

Pre Test (Yes/No): No

Date:

Inspector:

Hidden Damage:

During Teardown Inspection the following discrepancies were found:

RING GEAR IS PITTED BEYOND REPAIR. INPUT SHAFT SENT TO REWORK.MULTIPLE PARTS

ARE WORN. SEE PARTS LIST FOR PARTS REQUIRED.

Technician: RICHARD FRANKLIN

Date: 02-27-2018

Inspector: PATRICK SMITH

Corrective Action:

OVERHAULED AND TESTED IAW CMM 27-51-08, REV 35, DATED 11/01/2017.

C/W SB 767-27A0229, PART 2, REV ORIG IAW AD 2014-22-09.

Technician: KASEY LAIL

Date: 03-09-2018

Inspector: GARY MCCURRY

Curtiss-Wright
3120 Northwest Blvd
GASTONIA NC 28052
704-869-2300 Fax 704-869-2326

FAA CRS No : YCWR993K
Work Order : R10029601

Customer : A.J. WALTER AVIATION LTD

CSN: UNK

CSO: 000

CSR: 000

Cust Order: T30988

TSN: UNK

TSO: 000.00

TSR: 000.00

Outgoing : 256T3210-4

ACTUATOR

S/N: 0916

Part Detail:

Line#	Part Number/Description	Removal Code	QTY	Serial Number
10	256T3216-4	PT	1.00	
20	256T3229-1	WN	1.00	
30	256T3210-4KIT		1.00	
40	21000-0242		1.00	
50	21000-0243		1.00	
60	256T3282-1		1.00	
70	256T3292-1	CK	1.00	

Maintenance Release Record

The component identified above was overhauled in accordance with the current regulations of the Federal Aviation Administration, and is approved for return to service. Other pertinent details of the repair are on file at this repair station

Approved return to Service by: BRYAN LAMBERT

Date: 03-09-2018