

1. Approving Civil Aviation
Authority/Country:
FAA/United States

2. **AUTHORIZED RELEASE CERTIFICATE**
FAA Form 8130-3, AIRWORTHINESS APPROVAL TAG

3. Form Tracking Number:
20170003307397Y15
329036201

4. Organization Name and Address: Honeywell International Inc
4150 Lind Avenue SW
RENTON WA 98057

Repair Station
RN3R821L

5. Work Order/Contract/Invoice Number:
R321010
329036075
Page 1 of 1

6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial Number:	11. Status / Work:
001	RTA-44D VHF DATA RADIO	064-50000-0202	1	1391	REPAIRED

12. Remarks:

THE SERVICE SPECIFIED HAS BEEN ACCOMPLISHED IN ACCORDANCE WITH:
CMM 23-20-38 Rev 6, JUL/29/2016
SB 064-50000-23-4 Rev 0, APR/25/2013
SB RTA-44D-23-23 Rev 01, AUG/11/2000

UNIT ALSO MODIFIED

HH.DD (HH:MM)

TSR 0.00 (0:00)

CSR 0.00

MODS: AS RECEIVED PLUS UNIT MODS 15 AND 22

SEE ATTACHED DOCUMENTS AS APPLICABLE FOR WORK PERFORMED
HONEYWELL CERTIFIES THAT THE WORK SPECIFIED IN BLOCK 11/12 WAS CARRIED OUT IN ACCORDANCE WITH EASA PART 145 AND IN RESPECT TO THAT WORK THE COMPONENT IS CONSIDERED READY
FOR RELEASE TO SERVICE UNDER EASA PART 145 APPROVAL NO. EASA-145-4534

13a. Certifies the items identified above were manufactured in conformity to: <input type="checkbox"/> Approved design data and are in a condition for safe operation. <input type="checkbox"/> Non-approved design data specified in Block 12.		14a. <input checked="" type="checkbox"/> 14 CFR 43.9 Return to Service <input checked="" type="checkbox"/> Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.
13b. Authorized Signature:	13c. Approval/Authorization No.:	14b. Authorized Signature: <i>James W. Hibbitts Jr.</i>
13d. Name (Typed or Printed):	13e. Date(dd/mm/yyyy):	14c. Approval/Certificate No.: RN3R821L
		14d. Name (Typed or Printed): James W. Hibbitts Jr.
		14e. Date(dd/mm/yyyy): 06/JUL/2017

User / Installer Responsibilities

It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article. Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in Block 1. Statements in Blocks 13a and 14a do not constitute installation certification. In all cases, aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.



1. 国家 Country	2. 中国民用航空总局 CAAC	<input type="checkbox"/> 符合性 Conformity	<input checked="" type="checkbox"/> 适航性 Airworthiness	3. 证书编号 20170003307399Y05 329036201	Certificate Ref. No.
中国 China		批准放行证书/适航批准标签 AUTHORIZED RELEASE CERTIFICATE/AIRWORTHINESS APPROVAL TAG			

4. 单位 Organization Honeywell International Inc
4150 Lind Avenue SW
RENTON WA 98057

5. 工作单/合同单/发票
Work Order/Contract/Invoice
R321010
329036075
Page 1 of 1

6. 序号 Item	7. 内容 Description	8. 件号 Part No.	9. 适用性 Eligibility	10. 数量 Qty	11. 系列号/批号 Serial/Batch No.	12. 产品状态 Status/Work
001	RTA-44D VHF DATA RAD10	064-50000-0202	NOT KNOWN	1	1391	REPAIRED

13 备注 Remarks

THE SERVICE SPECIFIED HAS BEEN ACCOMPLISHED IN ACCORDANCE WITH:

CMM 23-20-38 Rev 6, JUL/29/2016

SB 064-50000-23-4 Rev 0, APR/25/2013

SB RTA-44D-23-23 Rev 01, AUG/11/2000

UNIT ALSO MODIFIED

HH, DD (HH:MM)

TSR 0.00 (0:00)

CSR 0.00

MODS: AS RECEIVED PLUS UNIT MODS 15 AND 22

SEE ATTACHED DOCUMENTS AS APPLICABLE FOR WORK PERFORMED

14. 新产品 New Parts

兹声明上述产品除第13项的其它规定以外, 已按照上述国家适航条例进行制造/检查, 并且该产品(出口产品)符合经批准的型号设计资料和进口国提出的专用要求。

Certifies that the part(s) identified above except as otherwise specified in block 13 was (were) manufactured/inspected in accordance with the airworthiness regulations of the stated country and/or in the case of parts to be exported with the approved design data and with the notified special requirements of the importing country.

16. 批准人签名
Signature

James W. Hibbitts Jr.

18. 批准日期
Date

JUL/06/2017

17. 批准人姓名 (打印的)
Name (Printed)

James W. Hibbitts Jr.

15. 使用过的产品 Used Parts

兹声明上述产品除第13项的其它规定以外, 已按照上述国家适航条例和进口国通知的特殊要求进行了工作, 该产品处于安全可用状态可以批准放行使用。

Certifies that the work specified above except as specified in block 13 was carried out in accordance with the airworthiness regulations of the stated country and the notified special requirements of the importing country and in respect to that work, the part(s) is(are) in condition for safe operation and considered ready for release to service. (over)

19. 中国民航总局授权
Issued by or on behalf of the CAAC

F00100101

AAC - 038(12/94)

* 参阅产品目录详细查找适用性

Cross - check eligibility for more details with parts catalogue



Certificate Of Conformance

3. Form Tracking Number:

20170003307398Y08
329036201

4. Organization Name and Address:

Honeywell International Inc
4150 Lind Avenue SW
RENTON WA 98057

5. Work Order/Contract/Invoice Number:

R321010
329036075

Page 1 of 1

6. Item:	7. Description:	8. Part Number:	9. Quantity:	10. Serial / Batch No:	11. Status / Work:
001	RTA-44D VHF DATA RADIO	064-50000-0202	1	1391	REPAIRED

12. Remarks :

THE SERVICE SPECIFIED HAS BEEN ACCOMPLISHED IN ACCORDANCE WITH:

CMM 23-20-38 Rev 6, JUL/29/2016

SB 064-50000-23-4 Rev 0, APR/25/2013

SB RTA-44D-23-23 Rev 01, AUG/11/2000

HH.DD (HH:MM)

TSR 0.00 (0:00)

CSR 0.00

MODS: AS RECEIVED PLUS UNIT MODS 15 AND 22

SW MODS: AS RECEIVED


SEE ATTACHED DOCUMENTS AS APPLICABLE FOR WORK PERFORMED

- 13 THE SERVICE SPECIFIED ABOVE WAS CARRIED OUT IN ACCORDANCE WITH THE DATA REFERENCED ABOVE AND/OR CUSTOMER DOCUMENTS. ALL SUPPORTING DOCUMENTATION IS ON FILE AND AVAILABLE FOR YOUR REVIEW.

14. Approval/Certificate No

N/A

15. Authorized Signature

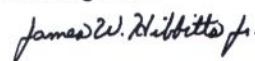

16. Date:

JUL/06/2017

17. Name (Typed/Printed):

James W. Hibbitts Jr.

SERVICE REPORT

AJW AVIATION LTD

800-601-3099 (T) 602-822-9194 (F)

SR NUMBER: 5011182710		329036201	FAA: RN3R821L	EASA: 145.4534
PO: R321010	CUSTOMER PART NUMBER:		CONTRACT NUMBER: 440067209	
DATE REJECTED: 21 JUN 2017	DATE RECEIVED: 26 JUN 2017		DATE COMPLETED: 06 JUL 2017	
A/C TYPE: A320-232	A/C TAIL NUMBER: SU-TCE		A/C SERIAL NUMBER: D0977	
PACKING STATUS: No	SEALS INTACT: Intact		PHYSICAL DAMAGE: No	
REASON FOR REMOVAL: PFR MSSG VHF'2'				
PART NUMBER	AS RECEIVED: 064-50000-0202		AS RELEASED: 064-50000-0202	
DESCRIPTION:	RTA-44D VHF DATA RADIO		RTA-44D VHF DATA RADIO	
SERIAL NUMBER	1391		1391	
UID(MFR/SPL PNO SER/UCN)				
HW MOD STATUS:	1-13, 17, 18		As received plus unit mods 15 and 22	
SW MOD STATUS:	02/02		As received	
SOFTWARE LOAD:				
REASON FOR REMOVAL CONFIRMED: Rejection Confirmed			ESTIMATE SUPPLIED: Yes	
PRIMARY SHOP FINDING: Hardware Fault Found			WARRANTY:	
TYPE OF SERVICE: REPAIRED/Modified			TECHNICIAN: Nicolaas Komen	
MAINTENANCE STATEMENT: PAGES DETAILING WORK PERFORMED, ALONG WITH MATERIALS USED, ARE ATTACHED IN PAGES 2 THROUGH 3				
SIGNATURE BELOW REQUIRED ONLY WHEN RETURN TO SERVICE IS NOT ISSUED: DATE: _____				
SIGNATURE OF AUTHORIZED PERSON: _____				
Complied With CMM/Eng Documentation: 23-20-38/Rev 6/Rev Date 29 JUL 2016; Service Bulletins: 064-50000-23-4/Rev 0/Rev Date 25 APR 2013; RTA-44D-23-23/Rev 01/Rev Date 11 AUG 2000;				
SHOULD YOU REQUIRE ANY FURTHER INFORMATION REGARDING THIS SERVICE REPORT, OR HAVE ANY QUESTIONS, PLEASE CONTACT OUR CUSTOMER RESPONSE CENTER AT 1-800-601-3099 OR VISIT OUR CUSTOMER PORTAL AT www.MyAerospace.com TO SUBMIT AN INQUIRY.				

SERVICE REPORT

AJW AVIATION LTD

800-601-3099 (T) 602-822-9194 (F)

SR NUMBER: 5011182710		FAA: RN3R821L	EASA: 145.4534
PO: R321010	CUSTOMER PART NUMBER:	CONTRACT NUMBER: 440067209	

Customer Manuals/Documentation: Previously Complied With CMM/Eng Documentation: Service Bulletins: Customer Manuals/Documentation:								
Work performed / Comments to Customer Unit Mods 15 and 22 were incorporated into the replacement RF Module. Equipment cal. dates checked and final tested by Nicolaas Komen on 07/04/2017. This component is airworthy with respect to the work performed.								
DISPOSITION	REF DSG	P/N Installed	S/N Installed	P/N Removed	S/N Removed	Qty	Primary Failure	SB
Replace	FIG3-1	30090239-0503	003692	30090239-0503	02035	1		
Replaced display module due to missing segments that make it hard to read.								
Replace	FIG1A-280A	30060236-0501	11070	30060236-0501	0314	1		
Replaced RF Module due to TX audio distortion, SELCAL/Data audio distortion, XMTR Modulation %, RF output power, and maximum transmit cutoff failures and fault codes Eb, Ek, El, Ej that were logged in BITE memory.								
Replace	C3106	09710384-0018		09710384-0018		1		
Replaced C3106 in power supply due to swelling and leaking fluid.								

SERVICE REPORT

AJW AVIATION LTD

800-601-3099 (T) 602-822-9194 (F)

SR NUMBER: 5011182710		FAA: RN3R821L	EASA: 145.4534
PO: R321010	CUSTOMER PART NUMBER:	CONTRACT NUMBER: 440067209	
MEASUREMENT DESCRIPTION	MEAS. VALUE (DECIMAL)	MEAS. VALUE (HH:MM)	
Time Since Repair		0:00	
Cycles Since Repair			

RTS TECHNICIAN

James W. Hilbert

DATE

JUL 06 2017