


1. Approving Competent Authority/Country CAA/UNITED KINGDOM		2.		AUTHORISED RELEASE CERTIFICATE EASA FORM 1			3. Form Tracking Number. 187577	
4. Organisation Name and Address. MUIRHEAD AEROSPACE LIMITED T/A MUIRHEAD AVIONICS 3 The Square Heathrow Southall Lane Southall, Middlesex UB2 5NH UNITED KINGDOM				5. Work Order/Contract/Invoice Work Order No: FR34093 Customer Order No: R327938				
6. Item	7. Description	8. Part No.	9. Qty.	10. Serial No.	11. Status/Work			
1	CVR	980-6005-076	1	13129	Repaired			
12. Remarks NO ULB ATTACHED TO UNIT Mods observed on identification plate: 2,5-18,19,21 + 27 Manual ID: 012-0296-001, Revision #: 15, Revision Date: 20/11/2012 Repair report attached reference FR34093 TCCA Approval Ref: 807-07				14 CFR 43.9 Return to Service The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to that work, the items are approved for return to service under certificate no. H9EY443N Date(m/d/y): Oct/26/2017 Signed:  				
13a. Certifies that the items identified above were manufactured in conformity to: ☐ approved design data and are in a condition for safe operation. ☐ non-approved design data specified in block 12				14a. ☒ Part-145.A.50 Release to Service ☐ Other regulation specified in Block 12 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part-145 and in respect to that work the items are considered ready for release to service.				
13b. Authorised Signature:		13c. Approval/Authorisation No.		14b. Authorised Signature  		14c. Certificate/Approval Ref No. UK.145.00592		
13d. Name		13e. Date (dd mmm yyyy)		14d. Name J. J. BLAIR		14e. Date (dd mmm yyyy) 26 Oct 2017		
USER/INSTALLER RESPONSIBILITIES This certificate does not automatically constitute authority to install the item(s). Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.								



Muirhead Aerospace Limited

Contact Name: Customer Services

Telephone: +44 020 8843 6952

Fax: +44 208 8571 2336

Tear Down/Inspection

Work Order #: FR34093

Date Printed: 26-Oct-17

Work Type: Readout

Page: 1

To:

ATTN: Elise Dubash **NEW CONTACT ALL Q
AJ WALTER (AVIATION) LTD
THE HEADQUARTERS
MAYDWELL AVENUE
SLINFOLD
WEST SUSSEX RH13 0AS

Ship To:

AJ WALTER (AVIATION) LTD
THE HEADQUARTERS
MAYDWELL AVENUE
SLINFOLD
WEST SUSSEX, RH13 0AS UK

Cust.PO Ref.: R327938

Cust.Phone: 01403 798 048

Cust.Email:

Cust.Code: 200382

Cust.Fax:

Station: SOUTH

Part No. In: 980-6005-076

Description: CVR

Qty: 1

Part No. Out: 980-6005-076

Serial No: 13129

Previous WO No:

Documentation: 012-0296-001

Location: SOU

ATA No: 23-70-40

Rev. & Date: 15 20-Nov-2012

Symptoms:

Inspection Report

REPORTED DEFECT:-
For readout

VISUAL INSPECTION:-
Satisfactory
ULB not attached

TEST / INSPECTION RESULTS:-
Unit inspected and tested - Unsatisfactory

FINDINGS / CORRECTIVE ACTIONS:-
Unit internally inspected - Noted defective capstan bearings - Replaced


O/P restored - No valid data

Heads reconditioned with rollers and guides

Unit assembled and tested to full spec

MODS EMBODIED:-
Nil

MOD PLATE STATUS:-
2,5-19,21 + 27

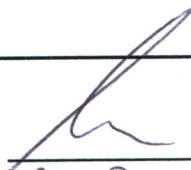Inspection Signature: 

Stamp: 

Inspect. Print Name: R.G. Piamma

Job No: FR34093	Work Order Scope and Traveller Muirhead Aerospace Limited	Date Printed: 13-Oct-17 Time: 1:20:20 PM Page: 1 of 1
Part No: 980-6005-076 Cust Code: 200382 OEM: HONEYWELL	Description: CVR Customer Name: AJ WALTER (AVIATION) LTD Date In: 10-Oct-17	Qty: 1 Serial No: 13129 Cust Ref No: R327938 Due Date: 17-Oct-17 Scheduled Date:
Documentation Used: 012-0296-001		ATA#: 23-70-40 Rev#: 15 20-Nov-2012
Task: WORK CARRIED OUT		Est. Time: 0 Sequence: 1

OP1. Visual Inspection: <i>No CRKs fitted.</i> Warranty seal intact Yes [] No [] OP2. Functional Test: <i>No OP.</i> Reported Defect Confirmed Yes [] No [] OP3. Malfunction Cause and Corrective Action: <i>UNIT FOUND IN DEFECTIVE CONDITION, CAPTIVE BEARINGS split. NEW BEARINGS fitted.</i> <i>OP BEARING, NOTE NO VALID AUDIO FOR BEARING.</i> <i>HEADS REPARATED BEARINGS, GUIDES + TAPE PATH CHECKED + LUBED.</i> <i>UNIT ALIGNED + ASSEMBLED.</i> <i>UNIT TESTED TO FULL COMM spec - PASS. IAW 23-70-40 R15 11/2012</i> <i>012-0296-001</i> MODS ON NEW PART: 2, 518, 1924 + 27 OP4. Mods / SBs / ADs Embodied: <i>None fitted THIS TIME.</i> OP5. Pre-Case FOD / Loose Articles Check: <i>No FOD</i>	D.O.M: 9122	Tech. J J J J J J J J J	Insp. MAA 9 MAA 9 MAA 9 MAA 9 MAA 9 MAA 9 MAA 9 MAA 9
Final Inspection and Test: Inspected By: <i>[Signature]</i> Date: <i>24/10/17</i>		Updated: [] Repaired: ☒ Inspected/Tested: ☒ Readout: [] Overhauled: [] Modified: [] Calibrated: []	
MAA 9		Final Insp. MAA 9	