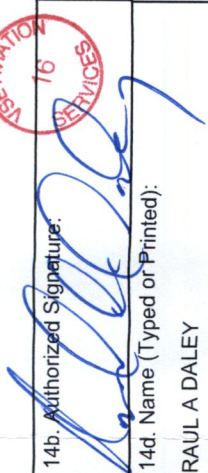


1. Approving Civil Aviation Authority/Country: FAA/UNITED STATES		2. AUTHORIZED RELEASE CERTIFICATE FAA FORM 8130-3, AIRWORTHINESS APPROVAL TAG		3. Form Tracking Number: FWO21477	
4. Organization Name and Address: VSE Aviation Services, Inc. 3361 Enterprise Way, Miramar, FL. 33025, Fax:954/430-6601, 954/430-6600				5. Work Order/Contract/Invoice Number: FWO21477 / R389301	
6. Item		7. Description:		8. Part Number:	
1		AUTOTHROTTLE SWPACK		254A1150-7	
9. Quantity:		10. Serial Number:		11. Status/Work:	
1.00		A4622		REPAIRED	
12. Remarks: This Item was REPAIRED I/A/W Manual # CMM 22-32-34, Revision # 32 Revision Date 11/1/2019					
NO APPLICABLE AD'S AND NO SB'S INSTALLED.					
Certifies that the work specified in block 11/12 was carried out in accordance with EASA Part 145 and in respect to that work the product/article is considered ready for release to service under EASA Part 145 Approval no. EASA.145.6610					
13a. Certifies the items identified above were manufactured in conformity to: ☐ Approved design data and are in a condition for safe operation. ☐ Non-approved design data specified in Block 12					
14a. ☒ 14 CFR 43.9 Return to Service ☒ Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Title 14, Code of Federal Regulations, part 43 and in respect to that work, the items are approved for return to service.					
13b. Authorized Signature:		13c. Approval Authorization No.:		14b. Authorized Signature: 	
13d. Name (Typed or Printed):		13e. Date (dd/mm/yyyy):		14c. Approval/Certificate No.: 9QAR940B	
				14d. Name (Typed or Printed): RAUL A DALEY	
				14e. Date (dd/mm/yyyy): 15-Dec-2021	
User/Installer Responsibilities					
It is important to understand that the existence of this document alone does not automatically constitute authority to install the aircraft engine/propeller/article.					
Where the user/installer performs work in accordance with the national regulations of an airworthiness authority different than the airworthiness authority of the country specified in Block 1. It is essential that the user/installer ensures that his/her airworthiness authority accepts aircraft engine(s)/propeller(s)/article(s) from the airworthiness authority of the country specified in Block 1.					
Statement in Blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.					
FAA Form 8130-3 (02-14)					
NSN:0052-00-012-9005					

WORK ORDER FORM 100

Page No. 1

VSE Aviation Services, Inc.

3361 Enterprise Way
Miramar, FL. 33025
Fax: 954/430-6601
954/430-6600

**FAA CRS No: 9QAR940B****Work Order #: FWO21477**

Step: SH-SHIPPING

Department: Shop FLA

Location: FLA ACC

Customer: **AJW001 / AJ WALTER AVIATION**Cust RO#: **R389301**Mfg: **BOEING**Outgoing: **254A1150-7 / AUTOTHROTTLE SWPACK*******NO PMA PARTS*****

S/N: A4622

Warranty Code: 00

Goodthru AD#:

Incoming P/N: 254A1150-7

Incoming S/N: A4622

Incoming work Req: RE

Outgoing Work Req: REPAIRED

Repair Manuals: F0475

RevDate: 11/1/2019

Rev#: 32

ATA: 22-32-34

Tools: FA0475,FA2687,FA0991,FA0400,FA0057,FA1584,FA1586,FA1744,FA0007,FA0092,

REASON FOR REMOVAL: Date Recvd: 12/6/2021 Date Reqd: 12/28/2021 Date Estmtd: 12/28/2021

AURAL WARNING ON TAKE-OFF.

PRELIMINARY INSPECTION: DATE: 12/7/2021 INSPECTOR: RAD

VERIFIED PN AND SN WITH ID PLATE AND RO.

PRE TEST (Yes/No): Y DATE: 12/7/2021 INSPECTOR: RAD

UNIT FAILED FUNCTIONAL TEST.

HIDDEN DAMAGE:

N/A.

TEARDOWN FINDINGS:

DURING TROUBLESHOOTING FOUND DEFECTIVE SWITCH S1, S7, S8, S9, S2, S3, AND S6 ALL
REQUIRES REPLACEMENT. UNIT TO BE REPAIRED.

TECHNICIAN: ESC

DATE: 12/7/2021

INSPECTOR: RAD

FINAL INSPECTION BEFORE ASSEMBLY DATE: 12/15/2021 INSPECTOR: RAD

CORRECTIVE ACTION:

THIS UNIT WAS DISASSEMBLED, CLEANED, INSPECTED, REPAIRED AS
NECESSARY, REASSEMBLED AND FUNCTIONALLY TESTED IN ACCORDANCE
WITH MANUFACTURER SPECIFICATIONS.

TECHNICIAN: ESC

DATE: 12/15/2021

INSPECTOR: RAD

MODIFICATION/SERVICE BULLETINS:

NO APPLICABLE AD'S AND NO SB'S INSTALLED.

TEST DATA USED:

ATA: 22-32-34 REV# 32 DATED 01NOV2019

Test Technician: ESC

Date: 12/15/2021

Final Inspection: RAD

Date: 12/15/2021

ADDITIONAL COMMENTS:

WORK ORDER FORM 100

Page No. 2

VSE Aviation Services, Inc.

3361 Enterprise Way
Miramar, FL. 33025
Fax: 954/430-6601
954/430-6600



FAA CRS No: 9QAR940B

Work Order #: FWO21477

Step: SH-SHIPPING

Department: Shop FLA

Location: FLA ACC

Customer: **AJW001 / AJ WALTER AVIATION**

Cust RO#: **R389301**

Mfg: **BOEING**

Outgoing: **254A1150-7 / AUTOTHROTTLE SWPACK**

*****NO PMA PARTS*****

S/N: A4622

Warranty Code: 00

Goodthru AD#:

Incoming P/N: 254A1150-7

Incoming S/N: A4622

Incoming work Req: RE

Outgoing Work Req: REPAIRED

N/A

MAINTENANCE RELEASE RECORD

THE COMPONENT IDENTIFIED ABOVE WAS REPAIRED IN ACCORDANCE WITH THE CURRENT REGULATIONS OF THE FEDERAL AVIATION ADMINISTRATION, AND IS APPROVED FOR RETURN TO SERVICE. OTHER PERTINENT DETAILS OF THE REPAIR ARE ON FILE AT THIS REPAIR STATION.

Approved For Return to Service by **RAUL A DALEY**

Date: 12/15/2021 4:11:11 PM

