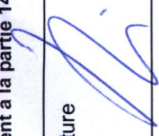


1. Approving Competent Authority / Country Autorité Compétente / Pays DIRECTION GENERALE DE L'AVIATION CIVILE FRANCE			2. AUTHORISED RELEASE CERTIFICATE Certificat Libératoire Autorisé EASA FORM 1 Formulaire 1 de l'EASA			3. Form Tracking Number. N° de repère du formulaire 0000187375									
4. Organisation Name and Address : Nom et Adresse de l'organisme :			Safran Landing Systems 7 rue Général Valérie André - Inovel Parc Sud 78140 Vélizy-Villacoublay - France			5. Work Order / Contract / Invoice Bon de commande / Contrat / Facture 7 5203894 10									
6. Item / Item		7. Description / Description		8. Part No / N° de pièce		9. Qty / Qté		10. Serial No / N° de série		11. Status / Work / Etat/Travaux					
1		MANIFOLD ALTERNATE BRAKE LH		D24005000-1		1		Y24315		REPAIRED					
12. Remarks <i>Remarques</i> - Work performed per CMM 32-47-54 Rev 02. - See TWR 5203894/10/885073 and TWR 5203894/10/885076 in appendix for more details on work performed. Equipment also covered by certificate number 0000187376 date 22/06/2021 "The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to that work, the items are approved for release or return to service under certificate no. M3BY435J."															
13a. Certifies that the items identified above were manufactured in conformity to: Certifie que les éléments identifiés ci-dessus ont été fabriqués conformément aux: ☐ approved design data and are in condition for safe operation. données de conception approuvées et sont en état de fonctionner en sécurité. ☐ non-approved design data specified in block 12. données de conception non approuvées spécifiées dans la case 12				14a. ☒ Part 145.A.50 Release to Service Approbation pour remise en service Selon Partie 145.A.50 Certifies that unless otherwise specified in block 12, the work identified in block 11 and described in block 12, was accomplished in accordance with Part 145 and in respect to that work the items are considered ready for release to service. Certifie que, sauf indication contraire spécifiée en case 12, les travaux identifiés en case 11 et décrits en case 12, ont été réalisés conformément à la partie 145 et qu'au vu de ces travaux, les pièces sont considérées prêtes à la remise en service.				14b. Authorised Signature Signature autorisée 				14c. Certificate / Approval Ref. No N° du Certificat / Agrément FR.145.0024			
13b. Authorised Signature Signature autorisée				13c. Approval/Authorisation Number Numéro d'agrément d'autorisation				14d. Name / Nom ROSIN Daniel , 52380				14e. Date (dd mmm yyyy)/Date (jj mmm aaaa) 22 Jun. 2021			
13d. Name / Nom															
USER/INSTALLER RESPONSIBILITIES / Responsabilités de l'utilisateur/installateur This certificate does not automatically constitute authority to install the item(s). Ce document ne constitue pas forcément l'autorisation d'installer l'item(s). Quand l'utilisateur/installateur travaille selon les réglementations d'une autorité de navigabilité différente de l'autorité de navigabilité mentionnée en case 1, il est essentiel que l'utilisateur/installateur s'assure que son autorité de navigabilité accepte les items libérés par l'autorité de navigabilité mentionnée dans la case 1. Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown. Les indications portées en cases 13a et 14a ne constituent pas une certification de montage. Dans tous les cas le dossier d'entretien de l'aéronef doit contenir une certification d'installation délivrée conformément aux règlements nationaux par l'utilisateur/installateur avant que l'aéronef puisse voler.															

1 国家 Country PEOPLE'S REPUBLIC OF CHINA	2. 中国民用航空总局 CAAC ☐ 符合性 Conformity ☒ 适航性 Airworthiness		3 证书编号 Certificate Ref. No. 0000187376	
批准放行证书/适航批准标签 AUTHORIZED RELEASE CERTIFICATE/AIRWORTHINESS APPROVAL TAG				
4 单位 Organization: Safran Landing Systems 7 rue Général Valérie André - Inovel Parc Sud 78140 Vélizy-Villacoublay - France				
6 序号 Item	7 内容 Description	8 件号 Part No.	9 适用性 Eligibility *	10 数量 Qty
1	MANIFOLD ALTERNATE BRAKE LH	D24005000-1	VARIOUS	1
5 工作单/合同单/货单 Work Order/Contract/Invoice 7 5203894 10				
11 系列号/批号 Serial/Batch No. Y24315				
12 产品状态 Status/Work REPAIRED				
13 备注 Remarks -Work performed per CMM 32-47-54 Rev 02. - See TWR 5203894/10/885073 and TWR 5203894/10/885076 in appendix for more details on work performed. Equipment also covered by certificate number 0000187375 date 22/06/2021				
14 新产品 New Parts 兹声明上述产品除第 13 项的其它规定以外, 已按照上述国家适航条例进行制造/检查, 并且该产品 (出口产品) 符合经批准的型号设计资料和进口国提出的专用要求。 Certifies that the Part (s) identified above except as otherwise specified in block 13 was(were) manufactured/inspected in accordance with the airworthiness regulations of the stated country and/or in the case of parts to be exported with the approved design data and with the notified special requirements of the importing country.			15 使用过的产品 Used Parts 兹声明上述产品除第 13 项的其它规定以外, 已按照上述国家适航条例和进口国通知的特殊要求进行了工作, 该产品处于安全可用状态可以批准放行使用。 Certifies that the work specified above except as specified in block 13 was carried out in accordance with the airworthiness regulations of the stated country and the notified special requirements of the importing country and in respect to that work, the part(s) is (are) in condition for safe operation and considered ready for release to service. (over)	
16 批准人签名 Signature		18 批准日期 Date 22 Jun. 2021		
17 批准人姓名 (打印的) Name (Printed)		19 中国民航总局授权 Issued by or on behalf of the CAAC CERTIFICATION N° F03300169		
ROSIN Daniel , 52380				

AAC-038(12/94)

*参阅产品目录详细查找适用性

Cross-check eligibility for more details with parts catalogue



SAFRAN LANDING SYSTEMS MRO
Etablissement de MOLSHEIM

FICHE D'EXAMEN REPARATEUR
TEST AND WORK REPORT

REF. 5203894
Feuille 1/2 10
Sheet 885073

Utilisateur : **A.J. WALTER AVIATION** N° de commande : **R382831** Bordereau de livraison :
Customer : **LTD.** Repair order N° : **Delivery sheet :**
Réglementation : **CAAC CCAR145** AVION : **A320** Date de réception : **07/05/2021**
Regulation : **EASAPart145/FAA14CFR Part145** Aircraft : **Date received :**
Désignation : **MANIFOLD ALTERNATE BRAKE LH** N° de série AV : **XA-VAO** Date de dépose : **28/04/2021**
Equipment description : **A/C N° :** **Date removed :**
Réf. à la réception : **D24005000-1** N° de série : **Y24315** Date de fabrication : **01/09/2015** Qté : **1**
P/N as received : **S/N :** **Manufacturing date :** **Qty :**

VIEILLISSEMENT TIME	Total TSN / CSN	Depuis révision TSO / CSO	Depuis installation TSI / CSI	Depuis réparation TSR / CSR
	/	/	/	/

Recours en garantie : **NO**
Warranty claim :

Réf. de livraison : **D24005000-1**
Delivery P/N :

Modifications (S.B.) :
Modification (S.B.) :

RAISON DE LA DEPOSE INDIQUEE PAR LE CLIENT
REASON FOR REMOVAL GIVEN BY THE CUSTOMER
**BRAKE ALTN SEROVLV - IF UNIT HAS BEEN MISHANDLED,
PLEASE**

**RECEPTION DISPUTE
TSN CSN MISSING ON R/O
PART IN EXCESS P/N ZAW623-01
S/N ASAR09562 DATE 06/2015**

**NOTE THIS MISHANDLING (NOT CID) AND PROVIDE REASONING AS TO
HOW THIS HAS OCCURED**

Fiabilité OEM consultée : **NO**
OEM Reliability consulted :

N° de colis :
Package N° :

Avarie / Prestation mentionnée confirmée : **NO**
Reported failure / Reason for removal confirmed :

Autres défauts trouvés : **YES**
Another failure found :

Statut si recours en garantie :
Status if warranty claimed :

Travail accompli svt : **CMM 32-47-54 Iss:02 REPARATION/REPAIR**
Work accomplished per :

----- Constatations et pièces à l'origine de l'avarie / Findings and part(s) causing failure : -----

TEST RESULTS

Not conform - Insulation resistance out of tolerance on
direct drive valve P/N: E21330001/1/A S/N: 10996

OTHERS

Partial disassembly

Parts in excess transducer P/N:ZAW623-01
S/N:ASAR09562,return with equipment

	Date / Date	Nom / Name	Signature / Visa
Insp. Finale Final insp.	JUN 22 2021	D. ROSIN	



SAFRAN LANDING SYSTEMS MRO
Etablissement de MOLSHEIM

FICHE D'EXAMEN REPARATEUR
TEST AND WORK REPORT

REF. 5203894
Feuille 2/2 10
Sheet 885073

Suite

MAIN REPLACED PARTS

Non followed parts

Designation / Received part number / Delivered part number	Quantity / Delivered serial number	Defaults	Parts causing failure	Part type	Default area	Observation
FILTER ASSEMBLY 27A04-84000-001 27A04-84000-001	1 111589	Insulation fault	No	New		
TORQUE MOTOR ASSY 27A04-91002-002 27A04-91002-002	1 F0143..	Insulation fault	No	New		
PRESSURE TRANSDUCER ASSY 27A04-91017-002 27A04-91017-002	1 103718-2	Insulation fault	No	New		



SAFRAN LANDING SYSTEMS MRO
Etablissement de MOLSHEIM

FICHE D'EXAMEN REPARATEUR
TEST AND WORK REPORT

REF. 5203894
Feuille 1/2 10
Sheet 885076

Utilisateur : A.J. WALTER AVIATION N° de commande : R382831 Bordereau de livraison :
Customer : LTD. Repair order N° : Delivery sheet :
Réglementation : CAAC CCAR145 AVION : A320 Date de réception : 07/05/2021
Regulation : EASAPart145/FAA14CFR Part145 Aircraft : Date received :
Désignation : BRAKE DIRECT DRIVE VALVE N° de série AV : XA-VAO Date de dépose : 12/05/2021
Equipment description : A/C N° : Date removed :
Réf. à la réception : E21330001-1/A N° de série : 10996 Date de fabrication : 01/08/2015 Qté : 1
P/N as received : S/N : Manufacturing date : Qty :

VIEILLISSEMENT TIME	Total TSN / CSN	Depuis révision TSO / CSO	Depuis installation TSI / CSI	Depuis réparation TSR / CSR
	/	/	/	/

Recours en garantie : NO Warranty claim : Réf. de livraison : E21330001-1/A Modifications (S.B.) :
Delivery P/N : Modification (S.B.) :

RAISON DE LA DEPOSE INDIQUEE PAR LE CLIENT
REASON FOR REMOVAL GIVEN BY THE CUSTOMER
BRAKE ALTN SEROVLV - IF UNIT HAS BEEN MISHANDLED, PLEASE
NOTE THIS MISHANDLING (NOT CID) AND PROVIDE REASONING AS TO
HOW THIS HAS OCCURED

Fiabilité OEM consultée : NO
OEM Reliability consulted :

N° de colis :
Package N° :

Avarie / Prestation mentionnée confirmée : YES
Reported failure / Reason for removal confirmed :

Autres défauts trouvés : YES
Another failure found :

Statut si recours en garantie :
Status if warranty claimed :

Travail accompli svt : CMM 32-47-63 Iss:00 REPARATION/REPAIR
Work accomplished per :

----- Constatations et pièces à l'origine de l'avarie / Findings and part(s) causing failure : -----

TEST RESULTS ON MANIFOLD

Not conform - Insulation resistance out of tolerance

OTHERS

Partial disassembly

	Date / Date	Nom / Name	Signature / Visa
Insp. Finale Final insp.	JUN 22 2021	D. ROSIN	



SAFRAN LANDING SYSTEMS MRO
Etablissement de MOLSHEIM

FICHE D'EXAMEN REPARATEUR
TEST AND WORK REPORT

REF.
Feuille 2/2
Sheet

5203894
10
885076

Suite

MAIN REPLACED PARTS

Non followed parts

Designation / Received part number / Delivered part number	Quantity / Delivered serial number	Defaults	Parts causing failure	Part type	Default area	Observation
TORQUE MOTOR ASSY 27A04-91002-002 27A04-91002-002	1 F0143..	Insulation fault	No	New		
FILTER ASSEMBLY 27A04-84000-001 27A04-84000-001	1 111589	Insulation fault	No	New		
PRESSURE TRANSDUCER ASSY 27A04-91017-002 27A04-91017-002	1 103718-2	Insulation fault	No	New		