


1. Approving Competent Authority/Country FEDERAL OFFICE OF CIVIL AVIATION (FOCA) SWITZERLAND	2.	AUTHORISED RELEASE CERTIFICATE EASA FORM 1		3. Form Tracking Number 85805847-10300
--	----	---	--	---

4. Organisation Name and Address <i>Meggitt SA, t/a Meggitt Sensing Systems</i> Route de Moncor 4, CH-1752 Villars-sur-Glâne, Switzerland Postal Address: PO Box 1616, CH-1701 Fribourg, Switzerland Phone: +41 (0)26 407 11 11 Fax: +41 (0)26 407 18 60		5. Work Order/Contract/Invoice Notification: 350324030 PO: T30517 Item:	
--	--	--	--

6. Item	7. Description	8. Part No.	9. Qty	10. Serial No.	11. Status / Work
10300	Engine Interface & Vib. Monitoring Unit	271-200-025-207	1	0689	REPAIRED

12. REMARKS This document has been issued according to an approved computer generated signature procedure. The work identified in Block 11 and described herein has been accomplished in accordance with 14 CFR part 43 and in respect to that work, the items are approved for return to service under certificate no. VM8Y694J. The work identified in block 11 and described in block 12 herein has been performed in accordance with Canadian requirements and is released to service under TCCA approval number 808-09. SN: (0689) MOD Strike:2 Applicable Technical Docs: CMM 73-25-36 Rev.6 Dated 12/14/2009 For work carried out, refer to Service Breakdown Report for Service Order 45234373	SHIP TO : A.J.WALTER AVIATION The Headquarters Maydwell Avenue WEST SUSSEX RH13 0AS Vereinigtes Königreich
---	--

13a. Certifies that the items identified above were manufactured in conformity to ☐ approved design data and are in a condition for safe operation ☐ non-approved design data specified in Block 12		14a. ☒ Part-145.A.50 Release to Service ☒ Other regulation specified in Block 12 Certifies that unless otherwise specified in Block 12, the work identified in Block 11 and described in Block 12 was accomplished in accordance with Part -145 and in respect to that work the items are considered ready for release to service
13b. Authorised Signature	13c. Approval/Authorisation Number	14b. Authorised Signature  VM - CS COA - 09 J. Berdet
13d. Name	13e. Date (dd mmm yyyy)	14c. Certificate/Approval Ref No. CH.145.0251
		14d. Name JOEL BERSET
		14e. Date (dd mmm yyyy) 17NOV/2017

USER/INSTALLER RESPONSIBILITIES
This certificate does not automatically constitute authority to install the item(s).
Where the user/installer performs work in accordance with regulations of an airworthiness authority different than the airworthiness authority specified in block 1, it is essential that the user/installer ensures that his/her airworthiness authority accepts items from the airworthiness authority specified in block 1.

Statements in blocks 13a and 14a do not constitute installation certification. In all cases aircraft maintenance records must contain an installation certification issued in accordance with the national regulations by the user/installer before the aircraft may be flown.

EASA Form1 -MF/145 Issue 2

1 国家 Country P. R. China		2. 中国民用航空总局 CAAC ☐ 符合性 Conformity		适航性 Airworthiness		3 证书编号 Certificate Ref. No. 4034	
批准放行证书/适航批准标签 AUTHORIZED RELEASE CERTIFICATE/AIRWORTHINESS APPROVAL TAG							
4 单位 Organization MEGİTT		5 工作单/合同单/货单 Work Order/Contract/Invoice 350324030					
7 内容 Description		8 件号 Part No.		9 适用性 Eligibility		10 数量 Qty	
1 6 序号 Item		Engine Interface & Vibration Monitoring Unit (EIVMU)		271-200-025-207 Mod. Record 2		Not known	
12 产品状态 Status/Work		11 系列号/批号 Serial/Batch No.		0689		Repaired	
13 备注 Remarks For work carried out refer to SBR No. : 45234373 Customer: A. J. WALTER AVIATION Customer' s P.O. No. : T30517 Delivery Note No. : 85805847							
14 新产品 New Parts 兹声明上述产品除第13项的其它规定以外, 已按照上述国家适航条例进行制造/检查, 并且该产品 (出口产品) 符合经批准的型号设计资料和进口国提出的专用要求。 Certifies that the Part(s) identified above except as otherwise specified in block 13 was(were) manufactured/inspected in accordance with the airworthiness regulations of the stated country and/or in the case of parts to be exported with the approved design data and with the notified special requirements of the importing country				15 使用过的产品 Used Parts 兹声明上述产品除第13项的其它规定以外, 已按照上述国家适航条例和进口国通知的特殊要求进行了工作, 该产品处于安全可用状态可以批准放行使用。 Certifies that the work specified above except as specified in block 13 was carried out in accordance with the airworthiness regulations of the stated country and the notified special requirements of the importing country and in respect to that work, the part(s) is (are) in condition for safe operation and considered ready for release to service. (over)			
16 批准人签名 Signature		18 批准日期 Date		19 中国民航总局授权 Issued by or on behalf of the CAAC F04100004			
17 批准人姓名 (打印的) Name (Printed)		J. Berset					


TEST REPORT

Subject: ACCEPTANCE TEST REPORT
Item: Engine Interface and Vibration Monitoring Unit
Type: EIVMU-101
MFR: S3960
PNR: 271-200-025-207
Cust. PNR: 63-9581-13-00
Mod. Record: 2
SER: 000689
DMF: 111996
Applicable Doc.: ATP-1047-07 rev 02
Software PNR: 299-500-000-014
Database PNR: 299-506-510-203
AU SER: AH76031
Operator: J.Chassot
Test Result: PASS
Started: 17 Nov 2017 08:56:14
Finished: 17 Nov 2017 09:32:01
Report generated: 17 Nov 2017 09:32:02
Report Location: \\ngts\atr\atp1047_07r02_eivmu207/P-000689-20171117-093202.html
GTS Hostname: gtsxp0011
Comment: ATP OUT

Signature:

Justin Chassot 

Department Approval:

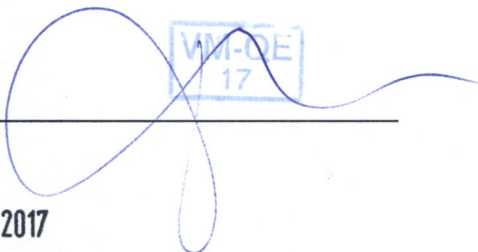Date of Approval:

17 NOV. 2017

Service Breakdown Report

Sold to
A.J.WALTER AVIATION
The Headquarters
Maydwell Avenue, Slinfold
WEST SUSSEX
RH13 OAS
UNITED KINGDOM

Page 1 of 2
Date 17.11.2017
Service notification 350324030
Meggitt quality notification
Service order/Report No 45234373
Sales order 9953270891
Customer PO# T30517
Customer quality ref
Customer Part#

Equipment serviced here

Item	Part number/ Description	Serial number	Mod Status/Revision
1	271-200-025-207 Engine Interface and Vibration Monitoring Unit(EIVMU) Applicable Technical Docs:	0689	2 / - CMM 73-25-36 Rev.6 Dated 12/14/2009

Failure / complaint (as reported by customer)

For repair
Please repair under T+M - quote and hold.
A/C: 9M-MKA Type: A330-322

EASA + FAA + TCCA + CAAC

Findings

Seal(s) ok and no physical damage has been noticed.
Failure downloaded at reception.
Self test is pass.
EERPOM on GPM will be replaced.

Materials

Item	Qty	UOM	Part Number	Batch Number	Description	Cond
1	1	EA	957.06.33.0102	0000707341	Eprom 8kx8	

Work performed

Incoming Inspection (Admin)
Preliminary hidden damage inspection
SB/SIL/AD status check performed
Visual Inspection
Failure confirmed
Check connectors condition
Read & Analyze Internal Memory
Incoming ATP Technician
Incoming ATP Test System
Repaired & recertified IAW CMM listed above
EEPROM IC13 on GPM replaced

Meggitt SA
P.O. Box 1616
CH-1701 Fribourg
Switzerland

Tel: +41 (0) 26 407 11 11
Fax: +41 (0) 26 407 17 00
www.meggittsensingsystems.com
www.meggitt.com

The Meggitt SA standard purchasing terms and conditions (GCP2008-04) or (GCC 2008-04) in effect at the date of this document shall apply and are available at www.meggittsensing.com. The GCP2008-04 is to be the default terms but the buyer needs the discretion to point to the other terms.
The SPOC document (Supplemental Purchase Order Conditions & Quality Requirements) forms an integral part of the Purchase order

Service Breakdown Report

Sold to
A.J.WALTER AVIATION
The Headquarters
Maydwell Avenue, Slinfold
WEST SUSSEX
RH13 OAS
UNITED KINGDOM

Page 2 of 2
Date 17.11.2017
Service notification 350324030
Meggitt quality notification
Service order/Report No 45234373
Sales order 9953270891
Customer PO# T30517
Customer quality ref
Customer Part#

Continued

Final ATP Technician
Final ATP Test System
Administration



Justin Chassot

Meggitt SA
P.O. Box 1616
CH-1701 Fribourg
Switzerland

Tel: +41 (0) 26 407 11 11
Fax: +41 (0) 26 407 17 00
www.meggittsensingsystems.com
www.meggitt.com

The Meggitt SA standard purchasing terms and conditions (GCP2008-04) or (GCC 2008-04) in effect at the date of this document shall apply and are available at www.meggittsensingsystems.com. The GCP2008-04 is to be the default terms but the buyer needs the discretion to point to the other terms.
The SPOC document (Supplemental Purchase Order Conditions & Quality Requirements) forms an integral part of the Purchase order